
PINEHURST DRIVE ZACHARY, LA 70808



Inspection Date: 5/3/18

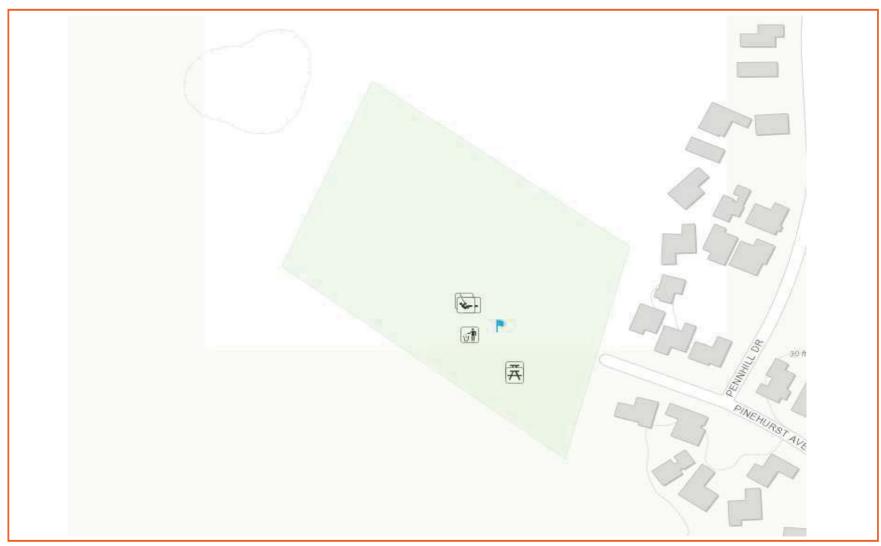



| | | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|---|-------|-------------|-----------|------------------|--|--|------------------|--|--------|----------|-------------------|---------------------------|
| | RE | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 1 | 3445 | Play Area. Large | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$8,000 | \$8,000 |
| | | 2 | 3535 | Play Area. Large | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$250,000 | \$250,000 |
| | | 3 | 3565 | Play Area | Playground; 1008.4.4 Entry Points and Seats | Entry Point/Seat - Height, not between 11 and 24 inches | 2 | Replace with a compliant entry point/seat. | Number | 1 | \$3,500 | \$3,500 |
| | | 4 | 3656 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | | 5 | 4888 | Picnic Area | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| T | TO TO | 6 | 4935 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

02-08-2019 Page 1/2





| REPORT GIS | LOCATIONS | BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|------------|-----------|-----------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | | CODES | | | | | | COST | PER ITEM |

Totals for Pinehurst Park


Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$262,370 |
|----|--------------------------------|-----------|
| 2) | Design Cost (8% of 1) | \$20,990 |
| 3) | Project Management (10% of 1) | \$26,237 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$309,597 |

02-08-2019 Page 2/2



19550 PLANK ROAD ZACHARY, LA 70791

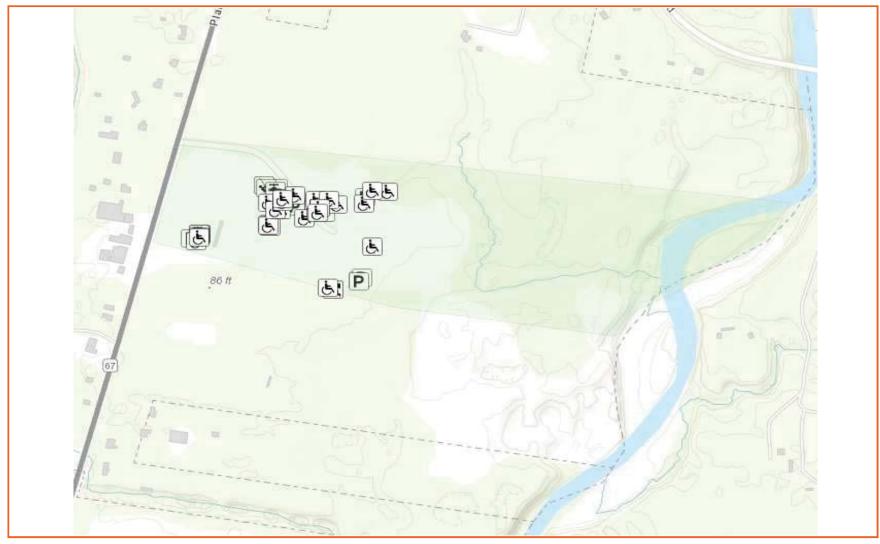

Inspection Date: 8/15/18





| 1000 | COO. | | | 20201 0110 0110 110 | cercation in East Baton Rouge Fan | | | | | | |
|------|--------|-----------|---------------|--|---|----------|---------------------|--------|----------|-------------------|---------------------------|
| F | REPORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 87 | Parking lot 1 | Accessible Parking Space; 502.2 Vehicle Spaces | Standard Accessible Marked Parking - Marking, missing | 1 | Provide marking. | Number | 1 | \$300 | \$300 |
| | 2 | 88 | Parking lot 2 | Accessible Parking Space; 502.2 Vehicle Spaces | Standard Accessible Marked Parking - Marking, missing | 1 | Provide marking. | Number | 2 | \$300 | \$600 |
| | 3 | 89 | Parking lot 3 | Accessible Parking Space; 502.2 Vehicle Spaces | Standard Accessible Marked Parking - Marking, missing | 1 | Provide marking. | Number | 1 | \$300 | \$300 |
| | 4 | 226 | Parking lot 1 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 5 | 227 | Parking lot 2 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 2 | \$40 | \$80 |
| | 6 | 228 | Parking lot 3 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |

02-08-2019 Page 1/12





| | 1000 | CODO | | | | creation in East Baton Rouge Fan | | | | | | |
|--------|------|--------------|-----------|---|---|---|----------|----------------------------|-------------|----------|-------------------|---------------------------|
| | F | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 7 | 347 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public sidewalks missing | 1 | Build an accessible route. | Linear Feet | 1000 | \$30 | \$30,000 |
| | | 8 | 371 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public sidewalks missing | 1 | Build an accessible route. | Linear Feet | 300 | \$30 | \$9,000 |
| | | 9 | 590 | To Dugout | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 5 | \$30 | \$150 |
| | | 10 | 591 | To Dugout | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 5 | \$30 | \$150 |
| · will | | 11 | 592 | Area of Sport Activity, To Baseball field 1 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 150 | \$30 | \$4,500 |
| | | 12 | 593 | To Baseball field's Restrooms | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 75 | \$30 | \$2,250 |

02-08-2019 Page 2/12





| 100CCC | | | | 2020 : 0.110 0.110 1.10 | creation in East Baton Rouge Fan | | | | | | |
|------------|---|-----------|--|--|---|----------|----------------------------|-------------|----------|-------------------|---------------------------|
| REPC IC | | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | 3 | 594 | Area of Sport Activity, To Baseball field 2 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 300 | \$30 | \$9,000 |
| 1 | 4 | 595 | Area of Sport Activity, To Baseball field 2 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 20 | \$30 | \$600 |
| | 5 | 596 | Area of Sport Activity, To Dugout. Field 2 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 10 | \$30 | \$300 |
| 1 | 6 | 597 | Area of Sport Activity, To Dugout. Field 2 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 10 | \$30 | \$300 |
| 1 | 7 | 598 | Area of Sport Activity, To Baseball field Assembly area | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 200 | \$30 | \$6,000 |
| 1 | 8 | 599 | Egress door from Gym | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 20 | \$30 | \$600 |

02-08-2019 Page 3/12





| | COUCI | | | 2010 I alks allu ke | creation in East Baton Rouge Pan | SII ADA ITAIISILIO | 11 1 1011 | | | | |
|-----|--------------|-----------|---|---|---|--------------------|-------------------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 19 | 600 | Egress door from Gym | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 30 | \$30 | \$900 |
| | 20 | 601 | Area of Sport Activity, To Baseball field and dugout | Accessible Route; 206.2.2 Within a Site | Accessible route missing to both dugouts and into sports field | 1 | Add compliant gate into the dugout. | Number | 1 | \$350 | \$350 |
| , L | 21 | 602 | Area of Sport Activity, To Baseball field 4 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 400 | \$30 | \$12,000 |
| | 22 | 834 | Men's restroom. Southwest of parking | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 1 | \$200 | \$200 |
| | 23 | 835 | Women's Restrooms. Southwest of parking | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 1 | \$200 | \$200 |
| | 24 | 908 | Gym | Accessible Route; 309.4 Operation | Door - Hardware - Operation, not operable with one hand | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |

02-08-2019 Page 4/12





| | COCO | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|--|--------------|-----------|---|---|---|----------|---|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 25 | 909 | Gym | Accessible Route; 309.4 Operation | Door - Hardware - Operation, not operable with one hand | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |
| | 26 | 990 | Interior | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 4 | \$500 | \$2,000 |
| | 27 | 1075 | Recreation Center, Egress door from Gym | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 28 | 1454 | Concession Stand | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 50 | \$30 | \$1,500 |
| | 29 | 1699 | Women's Restrooms. Baseball Field | Accessible Route; 403.4 Changes in Level | Walking surface - Changes in level, greater than 1/4 inches | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 30 | 1700 | Men's Restroom. Baseball field | Accessible Route; 403.4 Changes in Level | Walking surface - Changes in level, greater than 1/4 inches | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |

02-08-2019 Page 5/12





| | | 10 | | 2018 Parks and Re | ecreation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|--|--------------|-----------|--|---|---|------------------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 31 | 1777 | Recreation Center, Women's Restroom | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| | 32 | 1778 | Recreation Center, Men's Restroom | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| | 33 | 1921 | Restrooms at Baseball fields | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door - Clear floor space - Slope, greater than 1:48 (on the pull side) | 1 | Repave to have a compliant maneuvering clearance. | Number | 2 | \$1,300 | \$2,600 |
| | 34 | 1922 | Recreation Center | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |
| | 35 | 1989 | Maintenance shop | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door - Clear floor space - Slope, greater than 1:48 (on the pull side) | 1 | Repave to have a compliant maneuvering clearance. | Number | 1 | \$1,300 | \$1,300 |
| | 36 | 2265 | Area of Sport Activity | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 4 (for seating range 51 - 150) | 2 | Rebuild seats to provide a compliant number of wheelchair spaces. Add new bleachers/seating. | Number | 1 | \$6,000 | \$6,000 |

02-08-2019 Page 6/12





| | | COCO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fair | | | | | | |
|---|---------------------------------------|--------------|-----------|---------------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 37 | 2266 | Area of Sport Activity | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 4 (for seating range 51 - 150) | 2 | Rebuild seats to provide a compliant number of wheelchair spaces. Add new bleachers/seating. | Number | 1 | \$6,000 | \$6,000 |
| | | 38 | 2358 | Exterior | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |
| 7 | | 39 | 2514 | Exterior | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | | 40 | 2515 | Recreation Center | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | 41 | 2630 | Maintenance Shop | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 10/10 | 42 | 2731 | Maintenance Shop | Drinking Fountain; 602.2 Clear Floor Space | Drinking Fountain - Clear floor space - Knee clearance, height less than 27 inches | 2 | Replace with a compliant drinking fountain. | Number | 1 | \$2,500 | \$2,500 |

02-08-2019 Page 7/12





| | | COCO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fair | 31171271 1141131610 | | | | | |
|------|----------|--------------|-----------|---------------------|---|---|---------------------|---|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 43 | 2808 | Maintenance Shop | Lavatory/Sink; 606.2 Clear Floor Space | Sink - Clear floor space - Toe clearance - Depth, not between 17 and 25 inches | 2 | Reconfigure sink to provide toe clearance. | Number | 1 | \$1,350 | \$1,350 |
| | | 44 | 2823 | Maintenance shop | Miscellaneous Element; 307 Protruding Objects - A/C unit | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 2 | \$700 | \$1,400 |
| Sull | | 45 | 3344 | Parking lot 3 | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| | → | 46 | 3404 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| T. | | 47 | 3482 | Play Area. Small | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$1,000 | \$1,000 |
| | | 48 | 3546 | Play Area. Small | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$75,000 | \$75,000 |

02-08-2019 Page 8/12





| | UUU | | | 2010 alk3 alid ke | creation in East Baton Rouge Pan | SII ADA ITAIISILIO | 11 1 1011 | | | | |
|-----|-------------|-----------|---|--|--|--------------------|---|--------|----------|-------------------|---------------------------|
| R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 49 | 3879 | Men's Restrooms, Recreation Center | Restroom - Lavatory/Sink; 606.3 Height | Lavatory - Rim height, greater than 34 inches | 1 | Relocate the lavatory or replace lavatory. | Number | 1 | \$900 | \$900 |
| | 50 | 3880 | Women's Restrooms, Recreation Center | Restroom - Lavatory/Sink; 606.3 Height | Lavatory - Rim height, greater than 34 inches | 1 | Relocate the lavatory or replace lavatory. | Number | 1 | \$900 | \$900 |
| 101 | 51 | 3925 | Women's Restrooms, Baseball Field | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| | 52 | 3926 | Men's Restrooms, Baseball Field | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| | 53 | 4003 | Women's Restrooms, Baseball Field | Restroom - Lavatory/Sink; Advisory 606.1 General | Lavatory - Towel dispenser - Height, not between 15 and 48 inches | 3 | Relocate towel dispenser. | Number | 1 | \$40 | \$40 |
| 7 | 54 | 4130 | Men's Restrooms, Baseball Field | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | Replace water closet or relocate to a compliant location. | Number | 1 | \$950 | \$950 |

02-08-2019 Page 9/12





| | | | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|----|---|------------|-----------|--|---|---|----------|---|--------|----------|-------------------|---------------------------|
| | | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 3 | 55 | 4131 | Women's Restrooms, Baseball Field | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | Replace water closet or relocate to a compliant location. | Number | 1 | \$950 | \$950 |
| | | 56 | 4354 | Men's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.5.2 Rear Wall | Wheelchair Accessible Water closet - Rear grab bar - Length, less than 36 inches | 1 | Replace with a compliant rear grab bar. | Number | 1 | \$450 | \$450 |
| 14 | | 57 | 4574 | Women's Restrooms, Maintenance Shop | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| E. | | 58 | 4575 | Men's Restrooms, Maintenance Shop | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | | 59 | 4591 | Men's Restrooms, Southwest of parking lot | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |
| | 7 | 60 | 4592 | Men's Restrooms, Baseball Field | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |

02-08-2019 Page 10/12





| | | | | | creation in East Baton Rouge Fan | | | | | | |
|--|------------|-----------|--|-----------------------------|----------------------------------|----------|----------------------------|--------|----------|-------------------|---------------------------|
| | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 61 | 4652 | Men's Restrooms, Southwest of parking lot | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 62 | 4653 | Women's Restrooms, Southwest of parking lot | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 63 | 4654 | Men's Restrooms, Baseball Field | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 64 | 4655 | Women's Restrooms, Baseball Field | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 65 | 4656 | Men's Restrooms, Recreation Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| AT A | 66 | 4657 | Women's Restrooms, Recreation Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |

02-08-2019 Page 11/12





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|--|--|---|----------|--|--------|----------|-------------------|---------------------------|
| 67 | 4746 | Women's Restrooms, Maintenance Shop | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| 68 | 4747 | Men's Restrooms, Maintenance Shop | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| 69 | 5007 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| 70 | 5137 | Parking lot 2 | Van Accessible Parking Space; 502.6 Identification | Van Accessible Parking Space - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |

Totals for Plank Road Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$274,126 |
|----|--------------------------------|-----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$23,231 |
| 2) | Design Cost (8% of 1) | \$18,585 |
| 1) | Estimated Cost | \$232,310 |

02-08-2019 Page 12/12

15971 PORT HUDSON-PRIDE PRIDE, LA 70770



Inspection Date: 8/16/18





| | | | | ZUIO PAIKS AIIU NE | Liedtion in East Baton Rouge Pair | SII ADA ITAIISILIO | II FIdII | | | | |
|--------|--------------|-----------|---------------------|--|---|--------------------|---|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 233 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 2 | 350 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public sidewalks missing | 1 | Build an accessible route. | Linear Feet | 900 | \$30 | \$27,000 |
| | 3 | 606 | To Egress door | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | 4 | 607 | To Egrees door | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 60 | \$30 | \$1,800 |
| A Dece | 5 | 1472 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 6 | 1473 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |

02-08-2019 Page 1/4





| | | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|----|-------------|-----------|----------------------|---|---|----------|-----------------------------------|--------|----------|-------------------|---------------------------|
| RI | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 1474 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 8 | 2006 | Egress door | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | 9 | 2007 | Egress door | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | 10 | 2008 | Recreation Center | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | 11 | 2360 | Exterior | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |
| | 12 | 2361 | Interior | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |

02-08-2019 Page 2/4





| COCC | | | | 9 | | | | | | |
|--------------|-----------|---------------------------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 13 | 2521 | Interior | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| 14 | 3350 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| 15 | 3484 | Play Area. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$1,500 | \$1,500 |
| 16 | 3677 | Exterior | Receptacle; 308 Reach Ranges | Receptacle - Height, not between 15 and 48 inches | 3 | Replace with a compliant receptacle or adjust height. | Number | 1 | \$600 | \$600 |
| 17 | 3929 | Men's Restrooms, Baseball Field | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| 18 | 4004 | Men's Restrooms, Baseball Field | Restroom - Lavatory/Sink; Advisory 606.1 General | Lavatory - Towel dispenser - Height, not between 15 and 48 inches | 3 | Relocate towel dispenser. | Number | 1 | \$40 | \$40 |

02-08-2019 Page 3/4





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|---|--------------|-----------|--|--|--|----------|--|--------|----------|-------------------|---------------------------|
| 0 | 19 | 4525 | Men's Restrooms, Recreation Center | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| 0 | 20 | 4526 | Women's Restrooms, Recreation Cenrter | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| 9 | 21 | 4596 | Men's Restrooms, Baseball Field | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |
| | 22 | 5009 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |


Totals for Pride Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$85,727 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$7,265 |
| 2) | Design Cost (8% of 1) | \$5,812 |
| 1) | Estimated Cost | \$72,650 |

02-08-2019 Page 4/4

11207 NORWAY PINE DRIVE CENTRAL, LA 70739

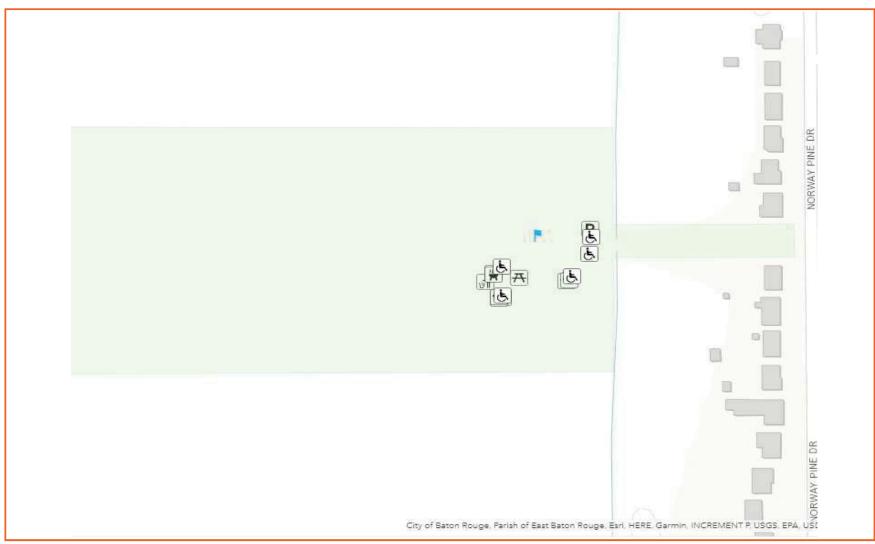

Inspection Date: 5/4/18





| | | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|---|---|--------------|-----------|-----------------------------|---|--|------------------|----------------------------------|-------------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 1 | 319 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 400 | \$30 | \$12,000 |
| | | 2 | 466 | Area of Sport Activity | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 30 | \$30 | \$900 |
| | | 3 | 467 | Play Area, To playground | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 50 | \$30 | \$1,500 |
| | | 4 | 468 | Play Area, To playground | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 30 | \$30 | \$900 |
| | | 5 | 2106 | Exterior | Accessible Route; 405.7.3 Length | Ramp - Top landing, length, less than 60 inches | 1 | Rebuild top landing. | Number | 1 | \$1,500 | \$1,500 |
| 4 | | 6 | 2753 | Exterior | Grill; 206.2.2 Within a site | Grill - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |

02-08-2019 Page 1/3





| | | | | | creation in East Baton Roage Fan. | | | | | | |
|----|------|-----------|-------------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| | | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| Z. | 7 | 2762 | Exterior | Grill; 308 Reach Ranges | Grill - Operable parts - Height, not between 15 and 48 inches | 3 | Replace with a compliant grill or adjust height. | Number | 1 | \$1,000 | \$1,000 |
| | 8 | 3311 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| A) | 9 : | 3457 | Play Area. Large | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$8,000 | \$8,000 |
| | 10 | 3458 | Playground 2. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$6,000 | \$6,000 |
| Æ, | 11 3 | 3510 | Play Area | Play Ground; 1008.3.1 Tranfer platforms | Transfer platform, missing | 2 | Provide a compliant Transfer system. | Number | 1 | \$3,500 | \$3,500 |
| 9 | 12 | 3511 | Playground 2 | Play Ground; 1008.3.1 Tranfer platforms | Transfer platform, missing | 2 | Provide a compliant Transfer system. | Number | 1 | \$3,500 | \$3,500 |

02-08-2019 Page 2/3





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|----------|--------------|-----------|--------------|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | 13 | 3570 | Playground 2 | Playground; 1008.4.4 Entry Points and Seats | Entry Point/Seat - Height, not between 11 and 24 inches | 2 | Replace with a compliant entry point/seat. | Number | 2 | \$6,000 | \$12,000 |
| U | 14 | 3651 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | 15 | 4960 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Railey Roshto Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com


| 4) | No Contingency Cost (Historic) | \$5,390 |
|----|--|--------------------|
| 2) | Design Cost (8% of 1) Project Management (10% of 1) | \$4,312 \$5,390 |
| 1) | Estimated Cost | \$53,900 |

02-08-2019 Page 3/3

BREC

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

23223 REAMES ROAD BATON ROUGE, LA 70791

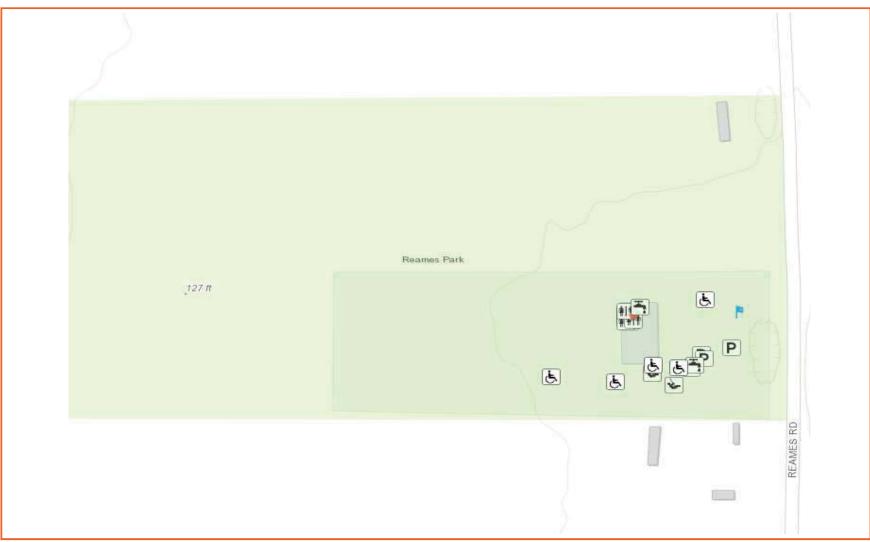

Inspection Date: 8/15/18





| | | COUC | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Nouge Fair | | | | | | |
|---|----|--------------|-----------|---|--|---|----------|----------------------------|-------------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 1 | 229 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | | 2 | 230 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | | 3 | 348 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public sidewalks missing | 1 | Build an accessible route. | Linear Feet | 250 | \$30 | \$7,500 |
| - | 7- | 4 | 603 | To Volleyball court | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 30 | \$30 | \$900 |
| | | 5 | 604 | Area of Sport Activity, To Baseball field and Assembly area | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 90 | \$30 | \$2,700 |
| | | 6 | 1455 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |

02-08-2019 Page 1/5





| | | | | 20201 0110 0110 110 | ereation in East Daton Nouge Fair | | | | | | |
|-----|-------------|-----------|----------------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPOR ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| q . | 7 | 2142 | Exterior | Accessible Route; 505.10.1 Top and Bottom Extension at Ramps | Ramp - Handrails - Extension on ramps, length less then 12 inches beyond the bottom ramp run in the direction of the ramp run | 1 | Provide compliant handrails. | Number | 1 | \$3,200 | \$3,200 |
| J | 8 | 2516 | Exterior | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 9 | 2517 | Recreation Center | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 10 | 2869 | Recreation Center | Miscellaneous Element; 307 Protruding Objects - Fire Extinguisher | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |
| | 11 | 3345 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | 12 | 3483 | Play Area. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$1,500 | \$1,500 |

02-08-2019 Page 2/5





| | MACION | | | | creation in East Baton Rouge Fan | | | | | | |
|---|--------------|-----------|---|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 13 | 3547 | Play Area. Medium | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$150,000 | \$150,000 |
| | 14 | 3792 | Men's Restrooms, Recreation Center | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| | 15 | 3793 | Women's Restrooms, Recreation Center | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| | 16 | 3881 | Men's Restrooms, Recreation Center | Restroom - Lavatory/Sink; 606.3 Height | Lavatory - Rim height, greater than 34 inches | 1 | Relocate the lavatory or replace lavatory. | Number | 1 | \$900 | \$900 |
| 1 | 17 | 4355 | Women's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.5.2 Rear Wall | Wheelchair Accessible Water closet - Rear grab bar - Extension from water closet centerline, less than 12 (one side) | 1 | Relocate rear grab bar. | Number | 1 | \$250 | \$250 |
| 8 | 18 | 4434 | Men's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 609.4 Position of Grab Bars | Wheelchair Accessible Water closet - Rear grab bar - Height, not between 33 and 36 inches | 1 | Relocate rear grab bar. | Number | 1 | \$250 | \$250 |

02-08-2019 Page 3/5





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|---|--|--|----------|--|--------|----------|-------------------|---------------------------|
| 19 | 4435 | Men's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 609.4 Position of Grab Bars | Wheelchair Accessible Water closet - Side grab bar - Height, not between 33 and 36 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |
| 20 | 4593 | Women's Restrooms, Recreation Center | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |
| 21 | 4658 | Women's Restrooms, Recreation Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| 22 | 4659 | Men's Restrooms, Recreation Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| 23 | 5008 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

02-08-2019 Page 4/5





| REPORT GIS | LOCATIONS E | BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|------------|-------------|-----------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | | CODES | | | | | | COST | PER ITEM |

Totals for Reames Road Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

02-08-2019 Page 5/5



2100 GREENOAKS DRIVE BATON ROUGE, LA 70815



Inspection Date: 8/2/18





| | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fan | | | | | | |
|-------------|-----------|--|---|--|----------|-----------------------------------|-------------|----------|-------------------|---------------------------|
| REPOR ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | 549 | Exterior | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 200 | \$30 | \$6,000 |
| 2 | 550 | Area of Sport Activity, To Dugouts | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 40 | \$30 | \$1,200 |
| 3 | 551 | Recreation Center, Egress doors | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| 4 | 552 | | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 80 | \$30 | \$2,400 |
| 5 | 903 | Indoor | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 3 | \$500 | \$1,500 |
| 6 | 1746 | Interior | Accessible Route; 404.2.2 Double-Leaf Doors and Gates | Door - Type, both of the leaves on a double-leaf door do not follow requirements | 1 | Replace door with compliant type. | Number | 1 | \$2,500 | \$2,500 |

02-08-2019 Page 1/4





| | | | | | creation in East Baton Roage Fair | | | | | | |
|---|------------|-----------|----------------------------------|---|---|----------|---|--------|----------|-------------------|---------------------------|
| | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| T | 7 | 1838 | Men's Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, hinge side approach, less than 54 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 8 | 1839 | Women's Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, hinge side approach, less than 54 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 9 | 2002 | Entry to Recreation center | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | 10 | 2244 | Exterior | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 2 (for seating range 26 - 50) | 2 | Rebuild or relocate seats to provide a compliant number of wheelchair spaces. | Number | 2 | \$1,300 | \$2,600 |
| | 11 | 2352 | Interior | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |
| | 12 | 2644 | Interior | Drinking Fountain; 307 Protruding Objects | Drinking Fountain - Protruding limits, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Install an apron. | Number | 1 | \$450 | \$450 |

02-08-2019 Page 2/4





| | | | | | o o | | | | | | |
|--------|--------------|------|----------------------|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 13 | 2868 | Interior | Miscellaneous Element; 307 Protruding Objects - Fire Extinguisher | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |
| | 14 | 3271 | Exterior | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 2 (for parking space range 26 - 50) | 1 | Build 1 accessible parking space and 1 van accessible parking space. | Number | 2 | \$2,100 | \$4,200 |
| | 15 | 3477 | Play Area. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$1,500 | \$1,500 |
| | 16 | 3576 | Play Area | Playground; 1008.4.4 Entry Points and Seats | Entry Point/Seat - Height, not between 11 and 24 inches | 2 | Replace with a compliant entry point/seat. | Number | 2 | \$3,500 | \$7,000 |
| 7 8 | 17 | 4190 | Women's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| B CALL | 18 | 4519 | Men's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |

02-08-2019 Page 3/4





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|----------------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| 19 | 4770 | Women's Restrooms | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| 20 | 4771 | Men's Restrooms | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| 21 | 4994 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Red Oaks Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$64,227 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$5,443 |
| 2) | Design Cost (8% of 1) | \$4,354 |
| 1) | Estimated Cost | \$54,430 |

02-08-2019 Page 4/4



6900 RIO DRIVE BATON ROUGE, LA 70812



Inspection Date: 5/3/18





| | | | | 2020 : 0:110 0:10 1:0 | creation in East Baton Roage Fair | | | | | | |
|------|---|-----------|--|--|---|----------|---|-------------|----------|-------------------|---------------------------|
| REP(| | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 191 | Parking space 1 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 2 | 328 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | 3 | 492 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 60 | \$30 | \$1,800 |
| | 4 | 493 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 80 | \$30 | \$2,400 |
| | 5 | 609 | Area of Sport Activity, To Baseball field Assembly area | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 260 | \$30 | \$7,800 |
| | 6 | 1322 | Parking Lot | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |





| 100 CORO | | | | _ | | | | | | |
|--------------|-----------|----------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 7 | 2219 | Baseball field | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 2 (for seating range 26 - 50) | 2 | Rebuild or relocate seats to provide a compliant number of wheelchair spaces. | Number | 2 | \$1,300 | \$2,600 |
| 8 | 2455 | Play Area | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| 9 | 3352 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| 10 | 4887 | Picnic Area | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| 11 | 4983 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

\$28,037

Proposed Budget (1+2+3+4)



(512) 410-7059 - www.alturalp.com



2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

| REPORT GIS | LOCATIONS | BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COS |
|----------------------------|----------------|----------------|-----------|----------|--------------------|------|---------------|---------------------|--------------|
| ID ID | | CODES | | | | | | COST | PER ITEN |
| Fotolo for Dio D | wixa Day | ماء | | | 1) | | | Estimated Cost | \$23,76 |
| Totals for Rio D | rive Par | ^r K | | | 2) | | Des | sign Cost (8% of 1) | \$1,90 |
| Altura Solutions | | | | | 3) | | Project Manag | gement (10% of 1) | \$2,37 |
| 4214 Medical Pkwy, Ste 201 | , Austin, TX 7 | 8756 | | | 4) | | No Continger | ncy Cost (Historic) | \$ |

5)



RITA STREET ZACHARY, LA 70791



Inspection Date: 5/7/18





| | | | 0 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Pian | | | | |
|-----|---|-------------|-----------|---|--|--|------------------|--|-------------|----------|-------------------|---------------------------|
| | R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 1 | 98 | Parking space 2 | Accessible Parking Space; 502.3 Access Aisle | Standard Accessible Marked Parking - Access aisle, missing | 1 | Build a compliant access aisle or restripe existing. | Number | 1 | \$1,800 | \$1,800 |
| | | 2 | 270 | Parking Lot, space 2 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |
| 11 | | 3 | 308 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 150 | \$30 | \$4,500 |
| | | 4 | 419 | Area of Sport Activity, To Soccer field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 50 | \$30 | \$1,500 |
| 7.0 | | 5 | 423 | Area of Sport Activity, To Baseball field and dugouts | Accessible Route; 206.2.2 Within a Site | Accessible route missing to both dugouts and into sports field | 1 | Add compliant gate into the dugout. | Number | 2 | \$350 | \$700 |
| | | 6 | 424 | Area of Sport Activity, To Restrooms and Baseball fields | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 500 | \$30 | \$15,000 |





| | | 0 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|-------------|--------------|-----------|--|--|--|------------------|---|-------------|----------|-------------------|---------------------------|
| R | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| EVEK | 7 | 886 | Exterior | Accessible Route; 309.4 Operation | Door - Hardware - Operation, not operable with one hand | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |
| 9 | 8 | 997 | Area of Sport Activity, To Baseball field and dugouts | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 100 | \$30 | \$3,000 |
| - Familiary | 9 | 1225 | Play Area | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 10 | 1817 | Area of Sport Activity | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Push-Latch side approach, less than 48 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| EVEK | 11 | 1818 | Check-out aisle/Sale, Service Counters | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, hinge side approach, less than 48 inches (perpendicular to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| Eve K | 12 | 1992 | Area of Sport Activity | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |





| | | COOL | | | | | | | | | | |
|---|---|--------|-----------|---------------------------|---|--|----------|--|-------------|----------|-------------------|---------------------------|
| | F | REPORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 13 | 2171 | Area of Sport Activity | Assembly Area; 206.2.2 Within a site | Assembly Area - Accessible route, missing | 2 | Relocate on an accessible route or provide an accessible route to the element. | Linear Feet | 50 | \$30 | \$1,500 |
| | | 14 | 2343 | Exterior | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |
| | | 15 | 2433 | Area of Sport Activity | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | | 16 | 2734 | Area of Sport Activity | Drinking Fountain; 602.3 Operable Parts | Drinking Fountain - Operable parts - Operation, not operable with one hand | 2 | Replace with a compliant drinking fountain. | Number | 1 | \$2,500 | \$2,500 |
| | ATTEN AND ADDRESS OF THE PARTY | 17 | 3267 | Parking Lot | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 4 (for parking space range 76 - 100) | 1 | Build additional accessible parking spaces to meet the minimum number required. | Number | 2 | \$2,100 | \$4,200 |
| 1 | | 18 | 3591 | Area of Sport Activity | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|----|--------------|-----------|---|---|--|----------|--|--------|----------|-------------------|---------------------------|
| SO | 19 | 4169 | Unisex Restrooms, Area of Sport Activity | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | 20 | 4940 | Play Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| | 21 | 5062 | Parking space 1 | Van Accessible Parking Space; 502.2 Vehicle Spaces | Van Accessible Marked Parking - Car space - Width less than 132 inches | 1 | Build a compliant space or restripe existing. | Number | 1 | \$1,800 | \$1,800 |
| | 22 | 5111 | Parking space 1 | Van Accessible Parking Space; 502.6 Identification | Van Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |

Totals for Rita Street Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$70,151 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$5,945 |
| 2) | Design Cost (8% of 1) | \$4,756 |
| 1) | Estimated Cost | \$59,450 |

5800 RIVER BEND LAKES DRIVE BATON ROUGE, LA 70820



Inspection Date: 5/9/18





| | UUU. | | | 2010 Parks allu ke | creation in East Baton Rouge Pair | SII ADA ITAIISILIO | II FIAII | | | | |
|--|--------------|-----------|---|---|--|--------------------|---|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 309 | To Right-of- Way. Farr Trail | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 80 | \$30 | \$2,400 |
| | 2 | 421 | Area of Sport Activity | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 25 | \$30 | \$750 |
| | 3 | 422 | Area of Sport Activity, Baseball Field. Farr Trail | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 200 | \$30 | \$6,000 |
| | 4 | 1231 | Farr Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |
| | 5 | 1232 | Farr Trail | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 6 | 1245 | Area of Sport Activity, Farr Trail. Tennis Court | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 2 | \$7,000 | \$14,000 |





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|------------|----------------------------------|--|----------|---|--------|----------|-------------------|---------------------------|
| 7 | 4904 | Farr Trail | Table; 307 Protruding Objects | Dining and work surfaces - Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Replace or relocate dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Riverbend Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$31,400 |
|----|--------------------------------|----------|
| 2) | Design Cost (8% of 1) | \$2,512 |
| 3) | Project Management (10% of 1) | \$3,140 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$37,052 |



5794 ROLLINS ROAD ZACHARY, LA 70791



Inspection Date: 5/7/18





| | COO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fan | | | | | | |
|--|--------|-----------|--|--|---|----------|--|-------------|----------|-------------------|---------------------------|
| | REPORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 307 | Play Area, To Right-of-Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | 2 | 995 | Area of Sport Activity, To Baseball field and dugouts | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 100 | \$30 | \$3,000 |
| | 3 | 1816 | Restroom | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, hinge side approach, less than 48 inches (perpendicular to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 4 | 2417 | Play Area | Drinking Fountain; 206.2.2 Within a site | Drinking Fountain - Accessible route, missing | 2 | Relocate on an accessible route. | Number | 1 | \$3,000 | \$3,000 |
| | 5 | 2418 | Area of Sport Activity | Drinking Fountain; 206.2.2 Within a site | Drinking Fountain - Accessible route, missing | 2 | Relocate on an accessible route. | Number | 1 | \$3,000 | \$3,000 |
| | 6 | 2429 | Play Area | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |





| | COCO | | | | ereation in East Daton Nouge Fair | | | | | | |
|--|--------------|-----------|---------------------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 2435 | Area of Sport Activity | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 8 | 2691 | lji | Drinking Fountain; 602.2 Clear Floor Space | Drinking Fountain - Clear floor space - Knee clearance, depth (9 inch height) not between 11 and 25 inches | 2 | Replace with a compliant drinking fountain. | Number | 1 | \$2,500 | \$2,500 |
| | 9 | 2815 | Play Area | Miscellaneous Element; 206.2.2 Within a site - Little library | Miscellaneous Element - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | 10 | 3209 | Play Area | Miscellaneous Element; 308 Reach Ranges - Little free library | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$60 | \$60 |
| | 11 | 3249 | Parking lot | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 3 (for parking space range 51 - 75) | 1 | Build 2 standard accessible parking spaces and 1 van accessible parking space. | Number | 3 | \$2,100 | \$6,300 |
| | 12 | 3494 | Play Area. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$1,500 | \$1,500 |





| | COUC | | | 20201 0110 0110 110 | creation in East Daton Rouge Fan | 01171271 1101101010 | | | | | |
|-----|--------------|-----------|----------------------------------|---|--|---------------------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 13 | 3506 | Play Area | Play Ground; 1008.3.1 Tranfer platforms | Transfer platform, missing | 2 | Provide a compliant Transfer system. | Number | 1 | \$3,500 | \$3,500 |
| | 14 | 3588 | Play Area | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 9 | 15 | 4166 | Men's Restrooms, Outside | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| 95 | 16 | 4168 | Women's Restrooms, Outside | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | 17 | 4933 | Play Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| 100 | 18 | 4934 | Play Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Clear floor space, surface not stable, firm or slip resistant | 3 | Rebuild walking surface. | Number | 1 | \$1,300 | \$1,300 |





| REPOR ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-------------|-----------|-----------|--------------------|-----------|----------|--------------------|------|----------|-------------------|---------------------------|
| | | | | | | 1) | | | Estimated Cost | \$45,160 |

Totals for Rollins Road Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$45,160 |
|----|--------------------------------|----------|
| 2) | Design Cost (8% of 1) | \$3,613 |
| 3) | Project Management (10% of 1) | \$4,516 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$53,289 |



1011 WEST ROOSEVELT STREET BATON ROUGE, LA 70802



Inspection Date: 5/8/18





| | COCO | | | 2020 : 0:10 0:10 110 | creation in East Daton Rouge Fan | | | | | | |
|---|--------------|-----------|--|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 420 | Area of Sport Activity, To Baseball field and dugouts | Accessible Route; 206.2.2 Within a Site | Accessible route missing to both dugouts and into sports field | 1 | Add compliant gate into the dugout. | Number | 2 | \$350 | \$700 |
| | 2 | 769 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 1 | \$200 | \$200 |
| 4 | 3 | 996 | Area of Sport Activity | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |
| | 4 | 2196 | Area of Sport Activity | Assembly Area; 206.2.2 Within a site | Assembly Area - Accessible route, missing | 2 | Relocate on an accessible route or provide an accessible route to the element. | Linear Feet | 250 | \$30 | \$7,500 |
| | 5 | 2325 | Exterior | Assembly Area; 802.1.2 Width | Wheelchair space - Width less than 36 inches | 2 | Move the bleacher | Number | 1 | \$0 | \$0 |
| | 6 | 3448 | Play Area. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$1,500 | \$1,500 |






| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| 7 | 3590 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 8 | 4875 | Picnic Area | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| 9 | 4942 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Knee clearance, depth (27 inch height), not between 8 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Roosevelt Street Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$13,771 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$1,167 |
| 2) | Design Cost (8% of 1) | \$934 |
| 1) | Estimated Cost | \$11,670 |

RUE LEBOUEF BATON ROUGE, LA 70810

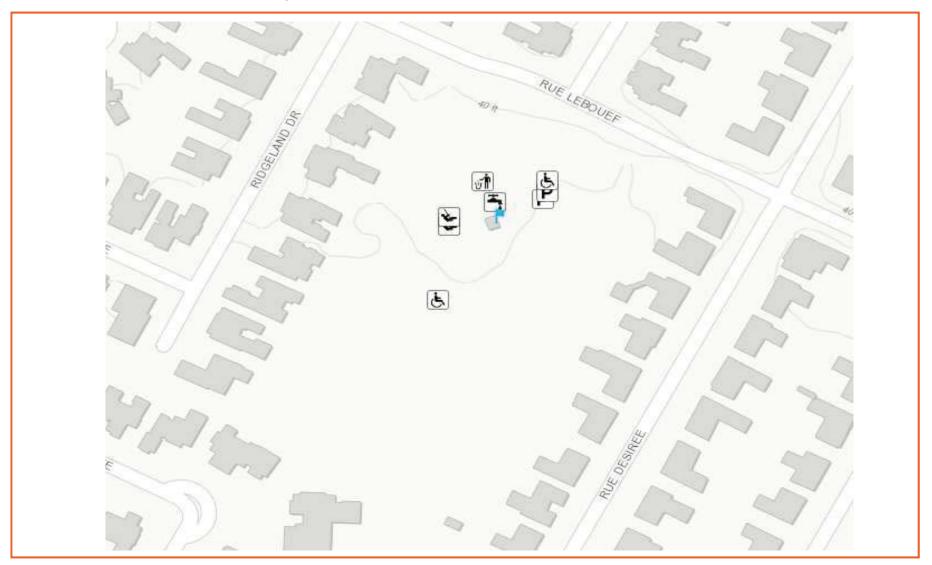

Inspection Date: 5/4/18





| | | COUC | | | ZUIO Faiks allu ke | creation in East Baton Rouge Pan | SII ADA HaliSitiO | II Flaii | | | | |
|---|----|--------------|-----------|---|--|---|-------------------|--|-------------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 1 | 165 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | | 2 | 304 | Parking Lot, To Right-of-Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 120 | \$30 | \$3,600 |
| | | 3 | 401 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 75 | \$30 | \$2,250 |
| 1 | jl | 4 | 2428 | Area of Sport Activity | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | | 5 | 3348 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| A | | 6 | 3440 | Play Area. Large | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$8,000 | \$8,000 |





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|---------------------------|--|--|----------|---|--------|----------|-------------------|---------------------------|
| 7 | 3522 | Play Area | Play Ground; 1008.3.1 Transfer Platforms | Transfer platform - Width less than 24 inches | 2 | Replace with compliant Transfer system. | Number | 1 | \$3,500 | \$3,500 |
| 8 | 3664 | Area of Sport Activity | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |

Totals for Rue LeBouef Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$26,243 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$2,224 |
| 2) | Design Cost (8% of 1) | \$1,779 |
| 1) | Estimated Cost | \$22,240 |

855 NORTH DONMOOR AVENUE BATON ROUGE, LA 70815



Inspection Date: 6/5/18





| | COCO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Roage Fair | 31171271 1141131610 | | | | | |
|---|--------------|-----------|---------------------------|---|---|---------------------|--|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | 1 | 1095 | Parking Lot | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 2 | 1933 | Recreation Center | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |
| | 3 | 1934 | Area of Sport Activity | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |
| | 4 | 1935 | Recreation Center | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |
| | 5 | 2540 | Recreation Center | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 6 | 2541 | Recreation Center | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |





| | | COCO | | | 2020 1 01110 0110 110 | creation in East Baton Rouge Fan | | | | | | |
|------------|---|--------------|-----------|-------------------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 113 | | 7 | 2780 | Recreation Center | Kitchen/Kitchenette; 804.4 Sinks | Sink - Rim height, greater than 34 inches | 3 | Relocate or replace sink. | Number | 1 | \$900 | \$900 |
| 11 | | 8 | 2781 | Recreation Center | Kitchen/Kitchenette; 804.4 Sinks | Sink - Clear floor space - Toe clearance - Depth, not between 17 and 25 inches | 3 | Provide compliant toe clearance. | Number | 1 | \$1,350 | \$1,350 |
| 8 9 | 8 | 9 | 2795 | Recreation Center | Kitchen/Kitchenette; 804.6.4 Range or Cooktop | Appliances - Cooktop - Controls - Location, requires reaching across burners | 3 | Provide a compliant cooktop. | Number | 1 | \$600 | \$600 |
| | | 10 | 2877 | Recreation Center | Miscellaneous Element; 307 Protruding Objects - Fire Extinguisher | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |
| 1 | | 11 | 2922 | Recreation Center | Miscellaneous Element; 307 Protruding Objects - TV | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |
| 113 | | 12 | 3215 | Kitchen/Kitchen ette | | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$700 | \$700 |





| | | | | | 2010 alks alid Ke | creation in East Baton Rouge Pan | SII ADA ITALISICIO | III I I I I I I I I I I I I I I I I I | | | | |
|--|----|-------------|-----------|---|--|---|--------------------|--|--------|----------|-------------------|---------------------------|
| | RE | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 13 | 3363 | Parking Lot | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| | | 14 | 3810 | Women's Restrooms 2, Recreation Center | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| The state of the s | | 15 | 3811 | Women's Restrooms 1, Recreation Center | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| el el | | 16 | 3939 | Men's Restrooms 1, Recreation Center | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| 4 | | 17 | 4085 | Men's Restrooms 1, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 603.4 Coat Hooks and Shelves | Coat hook - Height, greater than 48 inches | 3 | Relocate coat hook. | Number | 1 | \$40 | \$40 |
| -6 | | 18 | 4138 | Men's Restrooms 1, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | Replace water closet or relocate to a compliant location. | Number | 1 | \$950 | \$950 |





| | | | | | 2010 Paiks allu Ne | creation in East Baton Rouge Pan | SII ADA ITAIISILIO | II FIdII | | | | |
|----|------------|-----|-----------|---|---|--|--------------------|---|--------|----------|-------------------|---------------------------|
| | REPC ID | | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1: | 9 4 | 1161 | Women's Restrooms 1, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.3.1 Size | Wheelchair Accessible Water closet - Clearance - Length measured perpendicular from rear wall, less than 56 inches | 1 | Provide required clearance around water closet. | Number | 1 | \$2,800 | \$2,800 |
| 0 | 21 |) 4 | 1246 | Women's Restrooms 1, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.4 Seats | Wheelchair Accessible Water closet - Seats, not between 17 and 19 inches high | 1 | Replace water closet or the seat. | Number | 1 | \$950 | \$950 |
| 5 | 2 | 1 4 | 1294 | Men's Restrooms 2, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Extension from the rear wall, less than 54 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |
| -0 | 2. | 2 4 | 1295 | Women's Restrooms 1, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar, missing | 1 | Install side grab bar. | Number | 1 | \$450 | \$450 |
| 70 | 2. | 3 4 | 1366 | Women's Restrooms 1, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.5.2 Rear Wall | Wheelchair Accessible Water closet - Rear grab bar - Length, less than 36 inches | 1 | Replace with a compliant rear grab bar. | Number | 1 | \$450 | \$450 |
| | 2. | 4 2 | 1406 | Women's Restrooms 2, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.7 Dispensers | Toilet paper dispenser - Distance from the front of the water closet to dispenser centerline, not between 7 and 9 inches | 3 | Relocate dispenser to a compliant location. | Number | 1 | \$40 | \$40 |





| | | MACION | | | | ereation in East Daton Rouge Fan | | | | | | |
|----|---|--------------|-----------|---|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 18 | | 25 | 4676 | Women's Restrooms 2, Recreation Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 8 | 26 | 4677 | Men's Restrooms 1, Recreation Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | | 27 | 4678 | Women's Restrooms 1, Recreation Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| , | 6 | 28 | 4792 | Men's Restrooms 2, Recreation Center | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| | | 29 | 5021 | Parking Lot | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| | 1 | 30 | 5155 | Parking Lot | Van Accessible Parking Space; 502.6 Identification | Van Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |

\$39,270



(512) 410-7059 - www.alturalp.com




2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

| REPORT GIS ID ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | I UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-----------------------------|-----------|-----------------------------------|-----------|----------|--------------------|--------|---------------|---------------------|---------------------------|
| Totals for Saia P | Park | | | | 1) | | | Estimated Cost | \$33,280 |
| iotais ioi saia r | aik | | | | 2) | | Des | sign Cost (8% of 1) | \$2,662 |
| Altura Solutions | | | | | 3) | | Project Manag | gement (10% of 1) | \$3,328 |
| 4214 Medical Pkwy, Ste 201, | 4) | 4) No Contingency Cost (Historic) | | | | | | | |

5)

Proposed Budget (1+2+3+4)

10300 EL SCOTT AVENUE BATON ROUGE, LA 70811

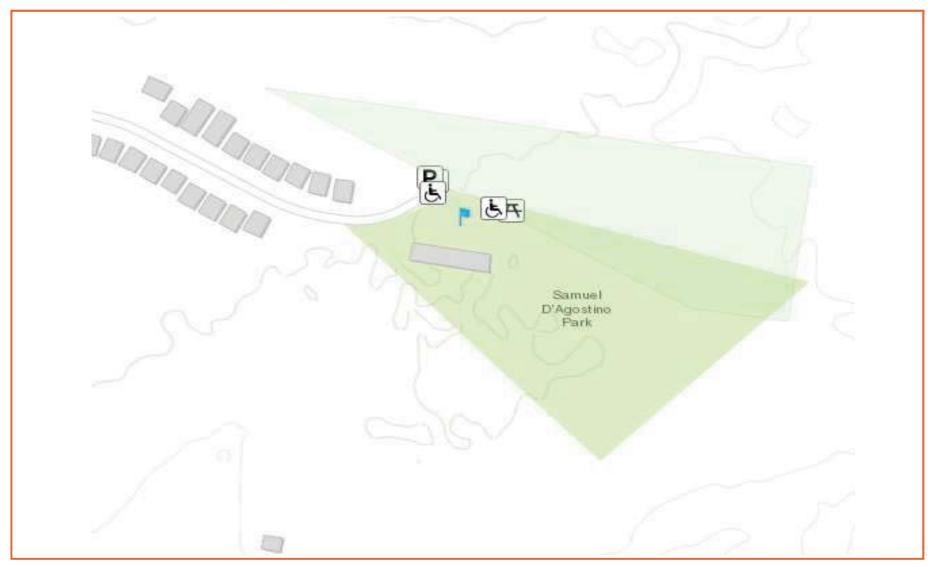

Inspection Date: 5/3/18





| 100 CACC | | | | or earlers in East Bates, neages and | | | | | | |
|--------------|-----------|---------------------|--|---|----------|--|-------------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | 180 | Parking space 1 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| 2 | 317 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 40 | \$30 | \$1,200 |
| 3 | 1244 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |
| 4 | 3309 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| 5 | 4959 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |



| REPORT GIS LOC | CATIONS BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|----------------|-------------------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | CODES | | | | | | COST | PER ITEM |


Totals for Samuel D'Agostino Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$5,040 |
|----|--------------------------------|---------|
| -/ | | . , |
| 2) | Design Cost (8% of 1) | \$403 |
| 3) | Project Management (10% of 1) | \$504 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$5,947 |



21572 CARSON ROAD PRIDE, LA 70770

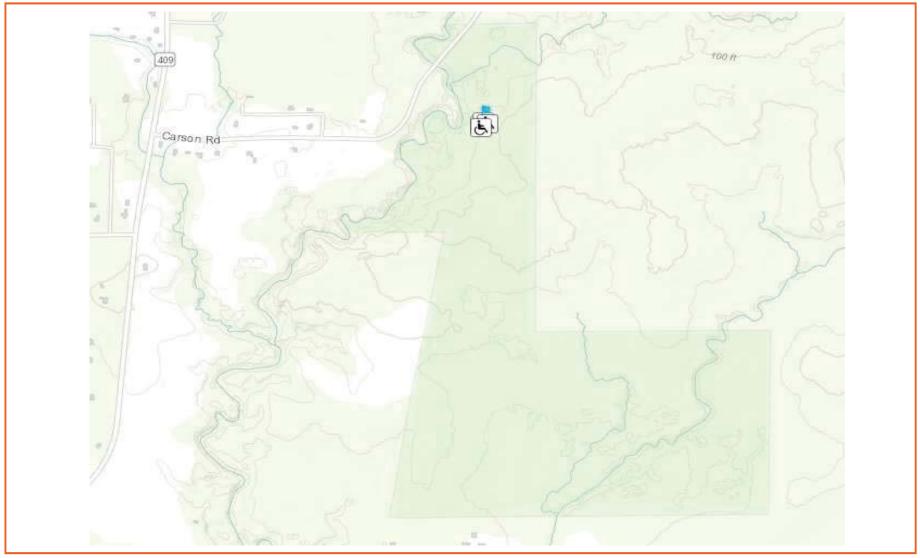

Inspection Date: 7/31/18







Historic

| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|---------------------|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| 1 | 351 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public sidewalks missing | 1 | Build an accessible route. | Linear Feet | 1250 | \$30 | \$37,500 |
| 2 | 608 | To Picnic table | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 40 | \$30 | \$1,200 |
| 3 | 3351 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| 4 | 5010 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Sandy Creek Community Park


Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$53,277 |
|----|----------------------------------|----------|
| 4) | Contingency (Historic, 11% of 1) | \$4,543 |
| 3) | Project Management (10% of 1) | \$4,130 |
| 2) | Design Cost (8% of 1) | \$3,304 |
| 1) | Estimated Cost | \$41,300 |

BREC

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

18460 SANTA MARIA PARKWAYT BATON ROUGE, LA 70817

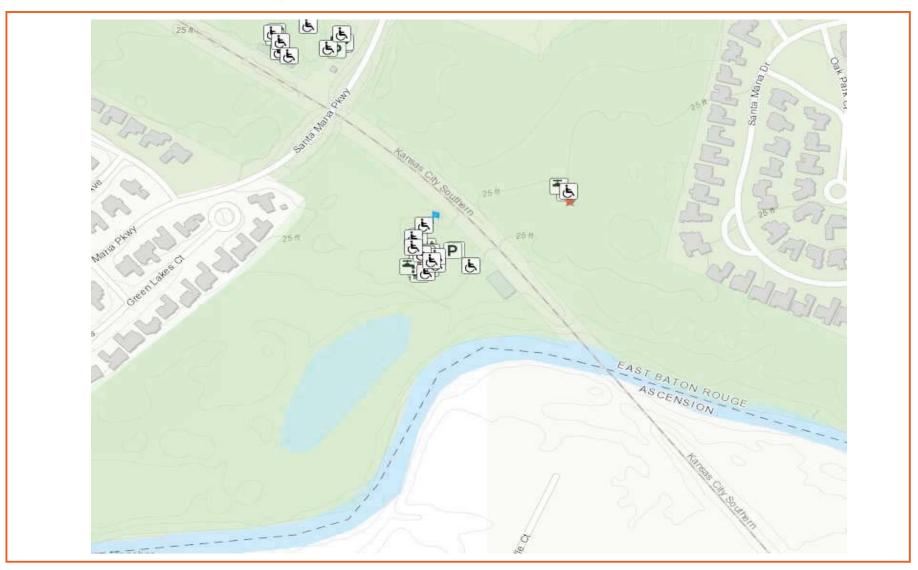

Inspection Date: 8/3/18





| | COOL | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Roage Fair | 31171271 1141131610 | | | | | |
|---|--------|-----------|---------------------------------|--|---|---------------------|---|-------------|----------|-------------------|---------------------------|
| | REPORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 282 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |
| | 2 | 283 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 7 | \$40 | \$280 |
| | 3 | 364 | Parking Lot, To Right-of-Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 250 | \$30 | \$7,500 |
| | 4 | 563 | To Maintenance yard | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| 8 | 5 | 906 | Maintenance yard | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 2 | \$500 | \$1,000 |
| | 6 | 1620 | Route to first tee. | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 70 | \$30 | \$2,100 |

02-08-2019 Page 1/11





| | COCO | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fair | | | | | | |
|---------|--------------|-----------|--|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 1808 | Golf Academy Storage Room | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| COLCE S | 8 | 1840 | Maintenance building | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Push-Latch side approach, less than 48 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 9 | 1855 | Women's pro shop Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, hinge side approach, less than 54 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 10 | 1856 | Men's pro shop Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, hinge side approach, less than 54 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 11 | 1912 | Maintenance yard | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |
| | 12 | 1962 | Women's restroom door. Golf Course | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |

02-08-2019 Page 2/11





| | COCO | | | 20101 4113 4114 116 | ereation in East Daton Rouge Fan | 31171071 1101131110 | | | | | |
|---|--------------|-----------|---|---|---|---------------------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 13 | 2033 | Pro Shop; Exit door from 109 Golf Academy | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | 14 | 2034 | Offices entry | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | 15 | 2099 | Parking Lot | Accessible Route; 405.4 Floor or Ground Surfaces | Ramp - Changes in level, greater than 1/4 inches | 1 | Rebuild ramp to have no changes in level. | Number | 1 | \$7,000 | \$7,000 |
| | 16 | 2118 | Exterior | Accessible Route; 405.8 Handrails | Ramp - Handrails - Missing on rump run with rise greater than 6 inches | 1 | Install compliant handrails on both sides. | Number | 1 | \$3,200 | \$3,200 |
| 7 | 17 | 2154 | Pro Shop | Accessible Route; 505.10.1 Top and Bottom Extension at Ramps | Ramp - Handrails - Extension on ramps, length less then 12 inches beyond the bottom ramp run in the direction of the ramp run | 1 | Provide compliant handrails. | Number | 1 | \$3,200 | \$3,200 |
| | 18 | 2369 | Interior | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |

02-08-2019 Page 3/11





| | COCO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fair | | | | | | |
|--|--------------|-----------|-------------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 19 | 2370 | Golf Academy | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |
| | 20 | 2480 | Maintenance building | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 21 | 2604 | Gym, Fitness Center | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 22 | 2605 | Gym, Champions Grill | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 23 | 2606 | Restroom | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 24 | 2733 | Fitness center | Drinking Fountain; 602.2 Clear Floor Space | Drinking Fountain - Clear floor space - Knee clearance, height less than 27 inches | 2 | Replace with a compliant drinking fountain. | Number | 1 | \$2,500 | \$2,500 |

02-08-2019 Page 4/11





| | UUUI | 0 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ada Transitio | n Pian | | | | |
|--------|-------------|-----------|---|--|--|------------------|--|--------|----------|-------------------|---------------------------|
| R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 25 | 2742 | Pro shop | Elevators; 407.4.1 Car Dimensions | Car dimensions - Area - Existing elevators, less than 16 square feet | 1 | Remove interior paneling to provide compliant size. | Number | 1 | \$3,000 | \$3,000 |
| | 26 | 2822 | Adjacent to 7th hole restroom building | Miscellaneous Element; 206.2.2 Within a site - Water Cooler | Miscellaneous Element - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | 27 | 2916 | Gym, Fitness center; Men's locker room. | Miscellaneous Element; 307 Protruding Objects - Shower curtain rod. | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |
| | 28 | 2917 | Gym, Women's locker room | Miscellaneous Element; 307 Protruding Objects - Shower rod | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |
| | 29 | 2927 | Gym, Fitness center; Champions Grill | Miscellaneous Element; 307 Protruding Objects - TV | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 3 | \$60 | \$180 |
| ****** | 30 | 3168 | Gym, Women's locker room | Miscellaneous Element; 308 Reach Ranges - Coat Hook | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$40 | \$40 |

02-08-2019 Page 5/11





| | | | | | 9 | | | | | | |
|-------|--------------|-----------|--------------------------------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 2 | 31 | 3169 | Men's pro shop Restrooms | Miscellaneous Element; 308 Reach Ranges - Coat Hook | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$40 | \$40 |
| | 32 | 3170 | Gym, Men's locker room | Miscellaneous Element; 308 Reach Ranges - Coat Hook | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$40 | \$40 |
| / 853 | 33 | 3386 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| | 34 | 3839 | Women's Restrooms, Golf Course | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| | 35 | 3863 | Women's Restrooms, Pro Shop | Restroom - Lavatory/Sink; 606.2 Clear Floor Space | Lavatory - Knee clearance - Height, less than 27 inches | 1 | Provide a compliant knee clearance. | Number | 1 | \$1,350 | \$1,350 |
| | 36 | 3864 | Men's Restrooms, Pro Shop | Restroom - Lavatory/Sink; 606.2 Clear Floor Space | Lavatory - Knee clearance - Height, less than 27 inches | 1 | Provide a compliant knee clearance. | Number | 1 | \$1,350 | \$1,350 |

02-08-2019 Page 6/11





| | | 0 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Pian | | | | |
|---------|--------------|-----------|--|---|--|------------------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 37 | 3963 | Women's Restrooms, Pro Shop | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| | 38 | 3964 | Men's Restrooms, Pro Shop | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| | 39 | 4034 | Women's Restrooms, Pro Shop | Restroom - Lavatory/Sink; Advisory 606.1 General | Lavatory - Towel dispenser - Height, not between 15 and 48 inches | 3 | Relocate towel dispenser. | Number | 1 | \$40 | \$40 |
| | 40 | 4035 | Men's Restrooms, Pro Shop | Restroom - Lavatory/Sink; Advisory 606.1 General | Lavatory - Towel dispenser - Height, not between 15 and 48 inches | 3 | Relocate towel dispenser. | Number | 1 | \$40 | \$40 |
| | 41 | 4066 | Men's Restrooms, Pro Shop | Restroom - Urinal; 605.3 Clear Floor Space | Urinal - Clear floor space - Width, less than 30 inches | 1 | Provide a compliant clear floor space. | Number | 1 | \$2,800 | \$2,800 |
| A-1-1-1 | 42 | 4067 | Men's Restrooms, Gym, Fitness center, locker room. | Restroom - Urinal; 605.3 Clear Floor Space | Urinal - Clear floor space - Width, less than 30 inches | 1 | Provide a compliant clear floor space. | Number | 1 | \$2,800 | \$2,800 |

02-08-2019 Page 7/11





| | | OCIOI | | | | creation in East Baton Rouge Fair | | | | | | |
|---|---|-------------|-----------|--|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| Ā | | 43 | 4093 | Gym, Fitness center, Women's locker room | Restrooms - Wheelchair Accessible Water Closet; 603.4 Coat Hooks and Shelves | Coat hook - Height, greater than 48 inches | 3 | Relocate coat hook. | Number | 1 | \$40 | \$40 |
| | | 44 | 4094 | Men's Restrooms, Gym, Fitness center; locker room. | Restrooms - Wheelchair Accessible Water Closet; 603.4 Coat Hooks and Shelves | Coat hook - Height, greater than 48 inches | 3 | Relocate coat hook. | Number | 1 | \$40 | \$40 |
| | | 45 | 4196 | Women's Restrooms, Maintenance building | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| 8 | | 46 | 4197 | Men's Restrooms, Maintenance building | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| 0 | | 47 | 4217 | Women's Restrooms, Pro Shop | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| 0 | 8 | 48 | 4218 | Men's Restrooms, Pro Shop | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |

02-08-2019 Page 8/11





| | | COOL | | | | ereation in East Daton Rouge Fan | | | | | | |
|-----|------|--------------|-----------|-----------------------------------|--|--|----------|---------------------------------------|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | - I | 49 | 4801 | Women's Restrooms, Pro Shop | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| | | 50 | 4802 | Men's Restrooms, Pro Shop | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| | | 51 | 4824 | Gym, Men's Restrooms | Shower Compartments; 213.3.6 Bathing Facilities | Compliant bathing facilities, less than 1 provided | 3 | Build a compliant shower compartment. | Number | 1 | \$4,200 | \$4,200 |
| w.c | | 52 | 4843 | Gym, Women's locker room | Shower Compartments; 608.3.3 Alternate Roll-in Type Shower Compartments; | Standard Roll-In Type Shower - Grab Bar - Location, above the seat | 3 | Relocate grab bar. | Number | 1 | \$250 | \$250 |
| W B | 135C | 53 | 4844 | Gym, Men's locker room | Shower Compartments; 608.3.3 Alternate Roll-In Type Shower Compartments; | Standard Roll-In Type Shower - Grab Bar - Location, above the seat | 3 | Relocate grab bar. | Number | 1 | \$250 | \$250 |
| | | 54 | 4850 | Gym, Women's locker room | Shower Compartments; 608.5.3 Alternate Roll-In Type Shower Compartments; | Standard Roll-In Type Shower - Controls - Height, greater than 48 inches | 3 | Install compliant controls. | Number | 1 | \$800 | \$800 |

02-08-2019 Page 9/11





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-----------------------------------|--|--|----------|---|--------|----------|-------------------|---------------------------|
| 55 | 4851 | Gym, Men's locker room | Shower Compartments; 608.5.3 Alternate Roll-In Type Shower Compartments; | Standard Roll-In Type Shower - Controls - Height, greater than 48 inches | 3 | Install compliant controls. | Number | 1 | \$800 | \$800 |
| 56 | 4862 | Room 109 Golf Academy | Sign; 703.4.2 Location | Sign - Location - Double leaf door (one active leaf), not located on the active leaf | 2 | Relocate signage. | Number | 1 | \$60 | \$60 |
| 57 | 4864 | Gym, Women's locker room | Storage/Lockers; 225.2.1 Lockers | Lockers, less than 5% (or less than 1) of each type | 3 | Provide at least 5% accessible lockers. | Number | 1 | \$600 | \$600 |
| 58 | 4865 | Men's pro shop Restrooms | Storage/Lockers; 225.2.1 Lockers | Lockers, less than 5% (or less than 1) of each type | 3 | Provide at least 5% accessible lockers. | Number | 1 | \$600 | \$600 |
| 59 | 4866 | Gym, Men's locker Restrooms | Storage/Lockers; 225.2.1 Lockers | Lockers, less than 5% (or less than 1) of each type | 3 | Provide at least 5% accessible lockers. | Number | 1 | \$600 | \$600 |

02-08-2019 Page 10/11





BREC

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

| REPORT GIS LOCATIONS BARRIERS; ID ID CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|---|-----------|----------|--------------------|------|----------|-------------------|---------------------------|
| Totals for Santa Maria Golf Co | urse | | 1) | | | Estimated Cost | \$113,440 |


Totals for Salita Walla Golf Course

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$113,440 |
|----|--------------------------------|-----------|
| 2) | Design Cost (8% of 1) | \$9,075 |
| 3) | Project Management (10% of 1) | \$11,344 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$133,859 |

02-08-2019 Page 11/11

18545 SANTA MARIA PARKWAY BATON ROUGE, LA 70817

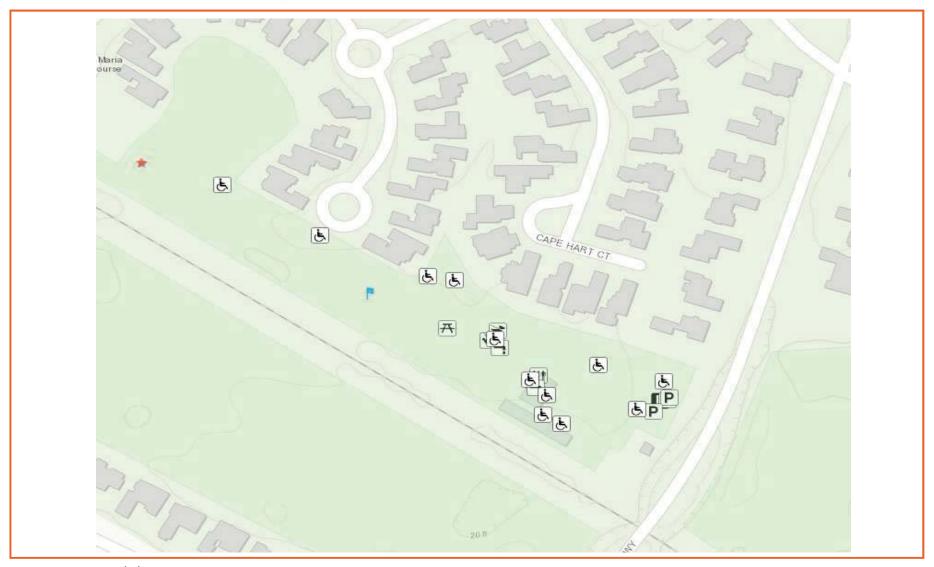

Inspection Date: 8/3/18





| | COCO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fair | | | | | | |
|--|--------------|-----------|-----------------------|--|---|----------|---|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 139 | Exterior | Accessible Parking Space; 502.4 Floor or Ground Surfaces | Standard Accessible Marked Parking - Clear floor space - Slope greater than 1:48 | 1 | Rebuild the space with compliant surface. | Number | 1 | \$1,800 | \$1,800 |
| | 2 | 216 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 3 | 338 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 50 | \$30 | \$1,500 |
| | 4 | 1049 | Parking Lot, Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 5 | 1381 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |
| | 6 | 1382 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 10 | \$30 | \$300 |

02-08-2019 Page 1/3





| | ado | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|---|-------------|-----------|-----------|---|--|----------|--|-------------|----------|-------------------|---------------------------|
| R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 1383 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |
| | 8 | 1384 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 9 | 1385 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 150 | \$30 | \$4,500 |
| | 10 | 1386 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |
| | 11 | 2485 | Trail | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 12 | 3014 | Trail | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 2/3





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-------------|--------------|-----------|----------------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | 13 | 3328 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| | 14 | 3429 | Trail | Pet Waste Bag Dispenser; 308 Reach Ranges | Pet Waste Bag Dispenser - Height, not between 15 and 48 inches | 3 | Replace with compliant dispenser or adjust height. | Number | 1 | \$350 | \$350 |
| | 15 | 3543 | Play Area. Medium | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$150,000 | \$150,000 |
| 20 5 | 16 | 4999 | Play Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Santa Maria Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com


| 5) | Proposed Budget (1+2+3+4) | \$196,930 |
|----|--------------------------------|-----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$16,689 |
| 2) | Design Cost (8% of 1) | \$13,351 |
| 1) | Estimated Cost | \$166,890 |

02-08-2019 Page 3/3





3200 HARDING BLVD BATON ROUGE, LA 70813

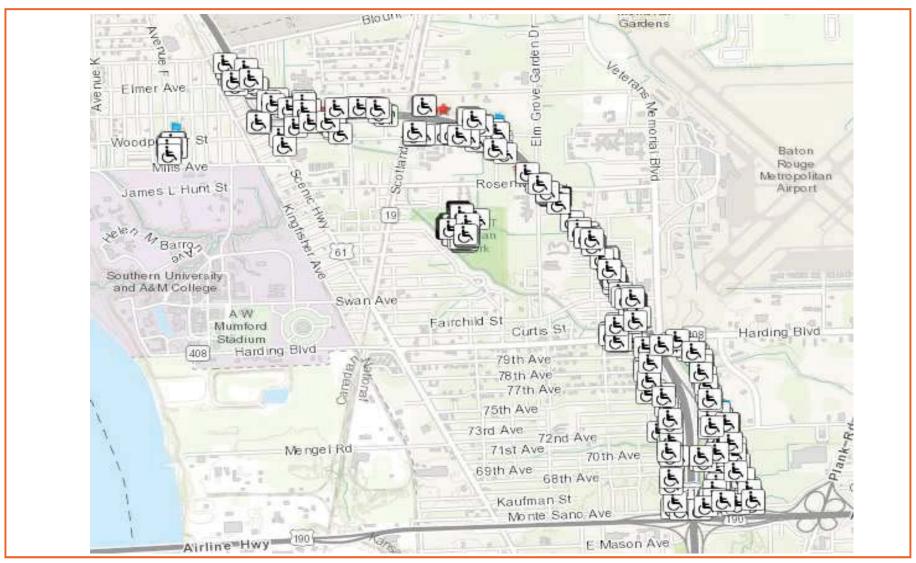

Inspection Date: 8/1/18





| | | UUUI | 10 | | 2018 Parks and Re | ecreation in East Baton Rouge Par | sn ADA Transitio | n Plan | | | | |
|-------|---|-------------|-----------|-----------|---------------------------------|---|------------------|------------------------|--------|----------|-------------------|---------------------------|
| | R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 1 | 2 | Exterior | Accesible Route; 405.2 Slope | Curb Ramp - Running slope, steeper than 1:12 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| e ret | | 2 | 3 | Exterior | Accesible Route; 405.2 Slope | Curb Ramp - Running slope, steeper than 1:12 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | | 3 | 4 | Exterior | Accesible Route; 405.2 Slope | Curb Ramp - Running slope, steeper than 1:12 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | | 4 | 5 | Exterior | Accesible Route; 405.2 Slope | Curb Ramp - Running slope, steeper than 1:12 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | | 5 | 6 | Exterior | Accesible Route; 405.2 Slope | Curb Ramp - Running slope, steeper than 1:12 | 1 | Rebuild the curb ramp. | Number | 2 | \$1,400 | \$2,800 |
| | | 6 | 8 | Exterior | Accesible Route; 405.2 Slope | Curb Ramp - Running slope, steeper than 1:12 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |

02-08-2019 Page 1/55





| | ado | | | 2020 1 01110 0110 110 | cercation in East Baton Rouge Fan | | | | | | |
|---|-------------|-----------|-----------|---------------------------------------|---|----------|------------------------|--------|----------|-------------------|---------------------------|
| R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 41 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 8 | 42 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 9 | 43 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 10 | 44 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 11 | 45 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 12 | 46 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |

02-08-2019 Page 2/55





| | COUC | | | ZUIO Paiks allu ke | creation in East Baton Rouge Pan | SII ADA ITAIISIUC | III FIdII | | | | |
|------|--------------|-----------|-----------|---------------------------------------|---|-------------------|------------------------|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| - | 13 | 47 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 14 | 48 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 15 | 49 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 16 | 50 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| 10 | 17 | 51 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| Ja . | 18 | 53 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |

02-08-2019 Page 3/55





| | COCO | | | | creation in East Baton Roage Fair | | | | | | |
|---|--------------|-----------|--|---|---|----------|------------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 19 | 54 | Exterior | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| 5 | 20 | 94 | Exterior | Accessible Parking Space; 502.2 Vehicle Spaces | Standard Accessible Marked Parking - Marking, missing | 1 | Provide marking. | Number | 1 | \$300 | \$300 |
| | 21 | 681 | Area of Sport Activity, To Dugouts. Both sides | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 60 | \$30 | \$1,800 |
| | 22 | 779 | Area of Sport Activity, Basketball Court | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 40 | \$200 | \$8,000 |
| | 23 | 780 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 10 | \$200 | \$2,000 |
| | 24 | 781 | Area of Sport Activity, Throughout path adjacent to Basketball and Tennis courts | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 16 | \$200 | \$3,200 |

02-08-2019 Page 4/55





| | | ado | | | | creation in East Daton Rouge Fan | | | | | | |
|-------|---|-------------|-----------|--|---|---|----------|------------------------------|--------|----------|-------------------|---------------------------|
| | R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 25 | 782 | Area of Sport Activity, Adjacent to Tennis courts | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 5 | \$200 | \$1,000 |
| 2 | | 26 | 783 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 2 | \$200 | \$400 |
| | | 27 | 784 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 20 | \$200 | \$4,000 |
| | | 28 | 785 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 10 | \$200 | \$2,000 |
| mac y | | 29 | 786 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 3 | \$200 | \$600 |
| | | 30 | 791 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 1 | \$200 | \$200 |

02-08-2019 Page 5/55





| | | 10 | | 2018 Parks and Re | ecreation in East Baton Rouge Pari | sn ADA Transitio | n Pian | | | | |
|------|---|-----------|---------------|---|---|------------------|---------------------------------|-------------|----------|-------------------|---------------------------|
| REP(| | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 797 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 2 | \$200 | \$400 |
| | 2 | 878 | Wooden Bridge | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Replace wood decking on bridge. | Number | 1 | \$1,200 | \$1,200 |
| 3 | 3 | 1000 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 400 | \$30 | \$12,000 |
| 3 | 4 | 1001 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 50 | \$30 | \$1,500 |
| | 5 | 1002 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |
| 3 | 6 | 1003 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 50 | \$30 | \$1,500 |

02-08-2019 Page 6/55





| | UUU | | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|---------|--------------|-----------|--|---|---|------------------|--------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| bond at | 37 | 1004 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 38 | 1005 | Area of Sport Activity, Baseball field | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| | 39 | 1006 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 40 | 1007 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 41 | 1008 | Both sides of Crosswalk | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 42 | 1009 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |

02-08-2019 Page 7/55





| | | | | 2020 : 01:10 0:10 1:10 | ereation in East Daton Rouge Fan | | | | | | |
|--|----------|-----------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| | ORT D | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 13 | 1010 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 14 | 1011 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 15 | 1012 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 46 | 1013 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 17 | 1014 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 125 | \$30 | \$3,750 |
| | 18 | 1022 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |

02-08-2019 Page 8/55





| | COCO | | | | ereation in East Daton Rouge Fan | | | | | | |
|----------------|--------------|-----------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| and the second | 49 | 1023 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |
| | 50 | 1024 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 51 | 1030 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 52 | 1031 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 53 | 1032 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 54 | 1033 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |

02-08-2019 Page 9/55





| | | | | cercation in East Baton Rouge Fair | | | | | | |
|-------------|-------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| REPOI ID | T GIS | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 55 | 1034 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| 56 | 1035 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| 57 | 1107 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 50 | \$30 | \$1,500 |
| 58 | 1108 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 80 | \$30 | \$2,400 |
| 59 | 1109 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| 60 | 1110 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |

02-08-2019 Page 10/55





| | CODO | | | | ereation in East Daton Rouge Fan | | | | | | |
|-----------|--------------|-----------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| R | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 61 | 1111 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| | 62 | 1112 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| | 63 | 1113 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| | 64 | 1114 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| to fin to | 65 | 1115 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| | 66 | 1116 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |

02-08-2019 Page 11/55





| | | | 2018 Parks and Re | ecreation in East Baton Rouge Par | ish ADA Transitio | n Plan | | | | |
|--------------|-----------|-----------|---|---|-------------------|--------------------------|-------------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 67 | 1117 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| 68 | 1118 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| 69 | 1119 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| 70 | 1120 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |
| 71 | 1121 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 80 | \$30 | \$2,400 |
| 72 | 1122 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |

02-08-2019 Page 12/55





| | | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|--|------------|-----------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 73 | 1123 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Replace wooden bridge. | Number | 1 | \$125,000 | \$125,000 |
| | 74 | 1124 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 75 | 1125 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| | 76 | 1126 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 77 | 1127 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| | 78 | 1128 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |

02-08-2019 Page 13/55





| | | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|--|------|-----------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| | PORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 79 | 1129 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| | 80 | 1130 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 81 | 1131 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 80 | \$30 | \$2,400 |
| | 82 | 1132 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| | 83 | 1133 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |
| | 84 | 1134 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |

02-08-2019 Page 14/55





| | | | | cercation in East Baton Rouge Fan | | | | | | |
|------------|------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| REPO ID | | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 85 | 1135 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| 86 | 1136 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |
| 87 | 1137 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 80 | \$30 | \$2,400 |
| 88 | 1138 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| 89 | 1139 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| 90 | 1140 | Exterior | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |

02-08-2019 Page 15/55





| | 100 COCC | | | | 9 | | | | | | |
|-------------|--------------|-----------|-----------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 91 | 1141 | At bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 92 | 1142 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 70 | \$30 | \$2,100 |
| | 93 | 1143 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 50 | \$30 | \$1,500 |
| | 94 | 1144 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| A 11 | 95 | 1145 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| <i>4</i> 7/ | 96 | 1146 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |

02-08-2019 Page 16/55





| | | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|--|------|-----------|-----------|---|---|----------|---|-------------|----------|-------------------|---------------------------|
| | PORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 97 | 1147 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 70 | \$30 | \$2,100 |
| | 98 | 1148 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |
| | 99 | 1149 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| | 100 | 1150 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 101 | 1151 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| | 102 | 1152 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface-Vertical clearance, less than 80" | 1 | Rebuild trail below bridge to provide compliant vertical clearance. | Number | 1 | \$40,000 | \$40,000 |

02-08-2019 Page 17/55





| | COCO | | | | ereation in East Daton Rouge Fan | | | | | | |
|--|--------------|-----------|---------------------------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 103 | 1153 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| | 104 | 1154 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 20 | \$30 | \$600 |
| | 105 | 1155 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 60 | \$30 | \$1,800 |
| | 106 | 1156 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 107 | 1157 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | 108 | 1158 | Trail to picnic tables | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 100 | \$30 | \$3,000 |

02-08-2019 Page 18/55





| | | | | 2020 : 01:10 0:10 1:10 | creation in East Baton Rouge Fan | | | | | | |
|------|-------|-----------|-----------------|---|---|----------|--------------------------|-------------|----------|-------------------|---------------------------|
| REPO | | ilS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | 09 1 | 159 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 20 | \$30 | \$600 |
| 1 | 10 11 | 160 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 100 | \$30 | \$3,000 |
| 1 | 11 11 | 161 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |
| 1 | 12 1: | 162 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| 1 | 13 1: | 163 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |
| 1 | 14 1: | 164 | Trail to bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 50 | \$30 | \$1,500 |

02-08-2019 Page 19/55





| | | JUDI | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|---------|----|-------------|-----------|--------------------|---|---|----------|---------------------------------|-------------|----------|-------------------|---------------------------|
| | RI | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 115 | 1165 | Trail to bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |
| | | 116 | 1166 | Adjacent to bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| All was | | 117 | 1193 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |
| | | 118 | 1194 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |
| | | 119 | 1195 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Replace wood decking on bridge. | Number | 1 | \$1,200 | \$1,200 |
| | | 120 | 1196 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 10 | \$30 | \$300 |

02-08-2019 Page 20/55





| | | | | 9 | | | | | | |
|--------------|-----------|---------------|---|---|----------|---------------------------------|-------------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 121 | 1197 | Parking Lot | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Remove curb from access aisle. | Number | 1 | \$250 | \$250 |
| 122 | 1198 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| 123 | 1199 | Trail by tree | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| 124 | 1200 | Bridge | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Replace wood decking on bridge. | Number | 1 | \$1,200 | \$1,200 |
| 125 | 1201 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 40 | \$30 | \$1,200 |
| 126 | 1202 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 30 | \$30 | \$900 |

02-08-2019 Page 21/55





| | 1000 | COCO | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|----|------|--------------|-----------|-----------|---|---|----------|---|-------------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 127 | 1203 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 15 | \$30 | \$450 |
| 33 | | 128 | 1246 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | | 129 | 1247 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | | 130 | 1248 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 100 | \$30 | \$3,000 |
| | 100- | 131 | 1249 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | | 132 | 1250 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 150 | \$30 | \$4,500 |

02-08-2019 Page 22/55





| | | | | 2018 Parks and Re | ecreation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|---|--------------|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 133 | 1251 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |
| | 134 | 1252 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 350 | \$30 | \$10,500 |
| | 135 | 1253 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 35 | \$30 | \$1,050 |
| | 136 | 1254 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 137 | 1255 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 15 | \$30 | \$450 |
| 2 | 138 | 1256 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |

02-08-2019 Page 23/55





| | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|----|------|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| | PORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 139 | 1257 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 120 | \$30 | \$3,600 |
| | 140 | 1258 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |
| 5 | 141 | 1259 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 200 | \$30 | \$6,000 |
| | 142 | 1260 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| 60 | 143 | 1261 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 60 | \$30 | \$1,800 |
| | 144 | 1262 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |

02-08-2019 Page 24/55





| | 10 | | 2018 Parks and Re | ecreation in East Baton Rouge Pari | sn ADA Transitio | n Pian | | | | |
|--------------|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 145 | 1263 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 12 | \$30 | \$360 |
| 146 | 1264 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 15 | \$30 | \$450 |
| 147 | 1265 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |
| 148 | 1266 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 60 | \$30 | \$1,800 |
| 149 | 1267 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 2 | \$7,000 | \$14,000 |
| 150 | 1268 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 15 | \$30 | \$450 |

02-08-2019 Page 25/55





| | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Pian | | | | |
|--|------------|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 151 | 1269 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 50 | \$30 | \$1,500 |
| | 152 | 1270 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |
| | 153 | 1271 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 140 | \$30 | \$4,200 |
| | 154 | 1272 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 70 | \$30 | \$2,100 |
| | 155 | 1273 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 75 | \$30 | \$2,250 |
| | 156 | 1274 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |

02-08-2019 Page 26/55





| | | | | 2020 : 01:10 0:10 1:10 | creation in East Baton Rouge Fair | | | | | | |
|----|------------|-----------|-----------|----------------------------------|---|----------|---|-------------|----------|-------------------|---------------------------|
| | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 157 | 1300 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 50 | \$30 | \$1,500 |
| 12 | 158 | 1301 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 75 | \$30 | \$2,250 |
| | 159 | 1302 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 75 | \$30 | \$2,250 |
| | 160 | 1303 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 200 | \$30 | \$6,000 |
| | 161 | 1304 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 200 | \$30 | \$6,000 |
| 3 | 162 | 1305 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 300 | \$30 | \$9,000 |

02-08-2019 Page 27/55





| | | 0 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|------------|----|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| REPO II | | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 10 | 53 | 1306 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 200 | \$30 | \$6,000 |
| 10 | 54 | 1307 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 120 | \$30 | \$3,600 |
| 10 | 55 | 1308 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 300 | \$30 | \$9,000 |
| 10 | 56 | 1309 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 10 | \$30 | \$300 |
| 10 | 57 | 1310 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 70 | \$30 | \$2,100 |
| 10 | 58 | 1311 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |

02-08-2019 Page 28/55





| | adol | | | 2020 : 0:10 0:10 110 | creation in East Baton Roage Fair | 31171271 1141131610 | | | | | |
|---|-------------|-----------|-----------|----------------------------------|---|---------------------|---|-------------|----------|-------------------|---------------------------|
| R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 169 | 1312 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 70 | \$30 | \$2,100 |
| | 170 | 1329 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 4 | \$7,000 | \$28,000 |
| | 171 | 1330 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 50 | \$30 | \$1,500 |
| | 172 | 1331 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 10 | \$30 | \$300 |
| | 173 | 1332 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 4 | \$7,000 | \$28,000 |
| | 174 | 1333 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 250 | \$30 | \$7,500 |

02-08-2019 Page 29/55





| | | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|---|---|-------------|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| | R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| A | | 175 | 1334 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 75 | \$30 | \$2,250 |
| | | 176 | 1335 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 50 | \$30 | \$1,500 |
| | | 177 | 1336 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 80 | \$30 | \$2,400 |
| | | 178 | 1337 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 120 | \$30 | \$3,600 |
| | | 179 | 1338 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 10 | \$30 | \$300 |
| | | 180 | 1339 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |

02-08-2019 Page 30/55





| | | | | 2020 : 01:10 0:10 1:10 | ereation in East Daton Rouge Fair | | | | | | |
|---------|------------|-----------|-----------|----------------------------------|---|----------|---|-------------|----------|-------------------|---------------------------|
| | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 181 | 1340 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 60 | \$30 | \$1,800 |
| | 182 | 1341 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 60 | \$30 | \$1,800 |
| | 183 | 1342 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 100 | \$30 | \$3,000 |
| | 184 | 1344 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 200 | \$30 | \$6,000 |
| | 185 | 1345 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 15 | \$30 | \$450 |
| | 186 | 1346 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |

02-08-2019 Page 31/55





| | | 12 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sh ADA Transitio | n Plan | | | | |
|-------|------------|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 187 | 1347 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 35 | \$30 | \$1,050 |
| | 188 | 1348 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 80 | \$30 | \$2,400 |
| Nel . | 189 | 1349 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 50 | \$30 | \$1,500 |
| | 190 | 1350 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 60 | \$30 | \$1,800 |
| | 191 | 1351 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 900 | \$30 | \$27,000 |
| | 192 | 1352 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 45 | \$30 | \$1,350 |

02-08-2019 Page 32/55





| | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|--------|------|-----------|-----------|----------------------------------|---|------------------|---|-------------|----------|-------------------|---------------------------|
| | PORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 193 | 1353 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |
| | 194 | 1354 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 100 | \$30 | \$3,000 |
| | 195 | 1355 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| ==1010 | 196 | 1547 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |
| | 197 | 1548 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 198 | 1549 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 2 | \$7,000 | \$14,000 |

02-08-2019 Page 33/55





| COOC | | | | | | | | | | |
|--------------|-----------|------------------------------|----------------------------------|---|----------|---|-------------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 199 | 1550 | Near pedestrian bridge | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 3 | \$7,000 | \$21,000 |
| 200 | 1551 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |
| 201 | 1552 | Trail | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 2 | \$7,000 | \$14,000 |
| 202 | 1553 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |
| 203 | 1554 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 120 | \$30 | \$3,600 |
| 204 | 1555 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 100 | \$30 | \$3,000 |

02-08-2019 Page 34/55





| | | | | 2020 : 0:10 0:10 110 | creation in East Baton Roage Fair | 31171271 1141131610 | | | | | |
|--|------|-----------|--------------------|----------------------------------|---|---------------------|---|-------------|----------|-------------------|---------------------------|
| | PORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 205 | 1556 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 206 | 1557 | Bridge | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Replace wood decking on bridge. | Number | 1 | \$1,200 | \$1,200 |
| | 207 | 1558 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 208 | 1559 | Adjacent to bridge | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 209 | 1560 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 4 | \$7,000 | \$28,000 |
| | 210 | 1561 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 60 | \$30 | \$1,800 |

02-08-2019 Page 35/55





| | JUDI | | | 2020 : 01:10 0:10 1:10 | ereation in East Daton Rouge Fair | | | | | | |
|----|-------------|-----------|-----------------|----------------------------------|---|----------|---|-------------|----------|-------------------|---------------------------|
| RI | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 211 | 1562 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |
| | 212 | 1563 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 213 | 1564 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |
| 1 | 214 | 1565 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 215 | 1566 | Trail at bridge | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 3 | \$7,000 | \$21,000 |
| | 216 | 1567 | Trail | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 2 | \$7,000 | \$14,000 |

02-08-2019 Page 36/55





| | COOL | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|---|--------------|-----------|-----------|----------------------------------|---|----------|---|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 217 | 1568 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 280 | \$30 | \$8,400 |
| > | 218 | 1569 | Trail | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 2 | \$7,000 | \$14,000 |
| | 219 | 1570 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 5 | \$7,000 | \$35,000 |
| 1 | 220 | 1571 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |
| | 221 | 1572 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |
| | 222 | 1573 | Trail | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |

02-08-2019 Page 37/55





| | | | | 2020 1 01110 0110 110 | er cation in East Daton Rouge Fan | | | | | | |
|---|------------|--------|-----------------|----------------------------------|---|----------|---|-------------|----------|-------------------|---------------------------|
| | REPO ID | | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 9 | 22 | 3 1629 | 9 Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 60 | \$30 | \$1,800 |
| | 22 | 1630 |) Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 22 | 5 1633 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 15 | \$30 | \$450 |
| | 22 | 5 1632 | 2 Wooden bridge | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Replace wooden bridge. | Number | 1 | \$125,000 | \$125,000 |
| | 22 | 7 1633 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |
| | 222 | 3 1634 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 40 | \$30 | \$1,200 |

02-08-2019 Page 38/55





| | | COO | | | | creation in East Daton Rouge Fan | | | | | | |
|---|---|--------------|-----------|-----------|---|--|----------|---|-------------|----------|-------------------|---------------------------|
| | F | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| - | | 229 | 1635 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 70 | \$30 | \$2,100 |
| | 1 | 230 | 1945 | Restroom | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door - Clear floor space - Slope, greater than 1:48 (on the pull side) | 1 | Repave to have a compliant maneuvering clearance. | Number | 2 | \$1,300 | \$2,600 |
| | | 231 | 2123 | Exterior | Accessible Route; 406 Curb Ramps | Curb ramp - Landing slope, steeper than 1:48 | 1 | Rebuild the curb ramp to have a compliant landing. | Number | 1 | \$1,400 | \$1,400 |
| | | 232 | 2137 | Exterior | Accessible Route; 406.4 Landings | Curb ramp - Landing, missing | 1 | Provide curb ramp landing. | Number | 1 | \$600 | \$600 |
| | | 233 | 2138 | Exterior | Accessible Route; 406.4 Landings | Curb ramp - Landing, missing | 1 | Provide curb ramp landing. | Number | 2 | \$600 | \$1,200 |
| | | 234 | 2139 | Exterior | Accessible Route; 406.4 Landings | Curb ramp - Landing, missing | 1 | Provide curb ramp landing. | Number | 1 | \$600 | \$600 |

02-08-2019 Page 39/55





| | COO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fair | | | | | | |
|-----|--------------|-----------|---------------------------|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 235 | 2165 | Exterior | Accessible Route; 505.4 Height | Ramp - Handrails - Height, not between 34 and 38 inches above walking surface | 1 | Install handrails at compliant height between 34 and 38 inches. | Number | 1 | \$3,200 | \$3,200 |
| | 236 | 2197 | Exterior | Assembly Area; 206.2.2 Within a site | Assembly Area - Accessible route, missing | 2 | Relocate on an accessible route or provide an accessible route to the element. | Linear Feet | 30 | \$30 | \$900 |
| | 237 | 2298 | Area of Sport Activity | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 4 (for seating range 51 - 150) | 2 | Rebuild seats to provide a compliant number of wheelchair spaces. Add new bleachers/seating. | Number | 1 | \$6,000 | \$6,000 |
| CV | 238 | 2401 | Exterior | Dining/Work Surface; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Clear floor space - Width, less than 30 inches | 3 | Provide a compliant clear floor space. | Number | 1 | \$1,300 | \$1,300 |
| | 239 | 2402 | Exterior | Dining/Work Surface; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Clear floor space - Width, less than 30 inches | 3 | Provide a compliant clear floor space. | Number | 1 | \$1,300 | \$1,300 |
| 472 | 240 | 2403 | Exterior | Dining/Work Surface; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance - Width, less than 30 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$2,400 | \$2,400 |

02-08-2019 Page 40/55





| | | | 2020 : 0:110 0:10 1:10 | er cation in East Daton Rouge Fan | | | | | | |
|------------|--------|------------|---|--|----------|--|--------|----------|-------------------|---------------------------|
| REPO ID | | | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 24 | 257 | 1 Exterior | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| 24 | 2 2940 | 0 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 24 | 3 294 | 1 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 24 | 294. | 2 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 24. | 5 294. | 3 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 24 | 5 294 | 4 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 41/55





| | 10 | | 2018 Parks and Re | ecreation in East Baton Rouge Par | ish ADA Transitio | n Plan | | | | |
|--------------|-----------|-----------|---|--|-------------------|---|--------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 247 | 2945 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 248 | 2946 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 249 | 2947 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 250 | 2948 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 251 | 2949 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 252 | 2951 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 42/55





| | | | | | 2010 1 at K3 at tu Ke | Creation in East Daton Rouge Pan | SII ADA ITALISICIO | III I I I I I I I I I I I I I I I I I | | | | |
|------|----|-------------|-----------|-----------|---|--|--------------------|---|--------|----------|-------------------|---------------------------|
| | RI | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 253 | 2952 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | | 254 | 2953 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | | 255 | 2954 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | | 256 | 2955 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| .14. | | 257 | 2956 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | | 258 | 2970 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 43/55





| | COCO | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|--|--------------|-----------|-----------|---|--|----------|---|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 259 | 2971 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 260 | 2972 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 261 | 2973 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 262 | 2974 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 263 | 2975 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 264 | 2976 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 44/55





| | | | 2018 Parks and Re | ecreation in East Baton Rouge Par | ish ADA Transitio | n Plan | | | | |
|-------------|------|-----------|---|--|-------------------|---|--------|----------|-------------------|---------------------------|
| REPOR ID | GIS | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 265 | 2977 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 266 | 2978 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 267 | 2979 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 268 | 2980 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 269 | 2981 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 270 | 2982 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 45/55





| | | | 2020 : 0:110 0:10 | ereation in East Daton Rouge Fan | | | | | | |
|-------------|--------|-----------|---|--|----------|---|--------|----------|-------------------|---------------------------|
| REPOI ID | RT GIS | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 272 | 2984 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 27/2 | 2985 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 273 | 2986 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 274 | 2987 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 279 | 2988 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 276 | 2989 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 46/55





| | | | 2018 Parks and Re | creation in East Baton Rouge Par | sn ADA Transitio | n Plan | | | | |
|--------------|-----------|-----------|---|--|------------------|---|--------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 277 | 2990 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 278 | 2991 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 279 | 2992 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 280 | 2993 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 281 | 2994 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 282 | 2995 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |

02-08-2019 Page 47/55





| | | | | er cation in East Daton Rouge Fan | | | | | | |
|------------|-------|------------|---|--|----------|--|--------|----------|-------------------|---------------------------|
| REPO ID | | | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 28 | 3 306 | 3 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 28 | 4 306 | 4 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 28 | 5 306 | 5 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 28 | 306 | 6 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 28 | 7 316 | 4 Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| 28 | 326 | 8 Exterior | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 2 (for parking space range 26 - 50) | 1 | Build 1 accessible parking space and 1 van accessible parking space. | Number | 2 | \$2,100 | \$4,200 |

02-08-2019 Page 48/55





| | | | 2020 1 01110 0110 110 | creation in East Daton Rouge Fan | | | | | | |
|-------------|-------|-----------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| REPOR ID | T GIS | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 289 | 3269 | Exterior | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 2 (for parking space range 26 - 50) | 1 | Build 1 accessible parking space and 1 van accessible parking space. | Number | 2 | \$2,100 | \$4,200 |
| 290 | 3276 | Exterior | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 5 (for parking space range 101 - 150) | 1 | Build 4 accessible standard parking spaces and 1 van accessible parking space. | Number | 5 | \$2,100 | \$10,500 |
| 291 | 3280 | Exterior | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 3 (for parking space range 51 - 75) | 1 | Build 1 accessible parking space and 1 van accessible parking space. | Number | 2 | \$2,100 | \$4,200 |
| 292 | 3373 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| 293 | 3389 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| 294 | 3390 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |

02-08-2019 Page 49/55





| | JUOI | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Roage Fair | 311712711101101010 | | | | | |
|----------|-------------|-----------|--|---|---|--------------------|--|--------|----------|-------------------|---------------------------|
| RI | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 295 | 3391 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | 296 | 3392 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | 297 | 3393 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | 298 | 3459 | Play Area. Medium. Log sculpture | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$6,000 | \$6,000 |
| 4 | 299 | 3460 | Play Area. Large | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$8,000 | \$8,000 |
| | 300 | 3461 | Play Area. Small | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$4,000 | \$4,000 |

02-08-2019 Page 50/55





| | OCC | | | | 2020 : 0:10 0:10 110 | creation in East Baton Rouge Fan | | | | | | |
|---|------------|-------|-----------|------------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | REPO II | | ilS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 30 | 01 3: | 538 | Play Area. Small | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$75,000 | \$75,000 |
| | 30 | 3.3 | 556 | Play Area. Large | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$250,000 | \$250,000 |
| | 30 | 3 3 | 607 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| T | 30 | 14 30 | 608 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | 30 | 31 | 618 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | 30 | 16 31 | 619 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |

02-08-2019 Page 51/55





| | | | | | creation in East Baton Rouge Fair | | | | | | |
|------------|------|---------|----------------------|--|--|----------|---|--------|----------|-------------------|---------------------------|
| REPO ID | | IS D | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 30 | 7 36 | | Basketball courts | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 30 | 8 36 | 627 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 30 | 9 36 | 628 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 31 | 0 36 | 658 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 31 | 1 36 | 674 | Exterior | Receptacle; 305.2 Floor or Ground Surfaces | Receptacle - Clear floor space - Slope, greater than 1:48 | 3 | Rebuild the walking surface to have cross slope less than 1:48. | Number | 1 | \$1,300 | \$1,300 |
| 31 | 2 36 | 675 | Exterior | Receptacle; 305.2 Floor or Ground Surfaces | Receptacle - Clear floor space - Slope, greater than 1:48 | 3 | Rebuild the walking surface to have cross slope less than 1:48. | Number | 1 | \$1,300 | \$1,300 |

02-08-2019 Page 52/55





| | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|----|-------------|-----------|----------------------|---|--|------------------|---|--------|----------|-------------------|---------------------------|
| RI | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 313 | 3678 | Exterior | Receptacle; 308 Reach Ranges | Receptacle - Height, not between 15 and 48 inches | 3 | Replace with a compliant receptacle or adjust height. | Number | 1 | \$600 | \$600 |
| | 314 | 3824 | Men's Restrooms | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| | 315 | 3825 | Women's Restrooms | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| T. | 316 | 4605 | Men's Restrooms | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |
| 1- | 317 | 4700 | Men's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| - | 318 | 4701 | Women's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |

02-08-2019 Page 53/55





| | | COO | | | 20201 0110 0110 110 | cercation in East Daton Rouge Fan | | | | | | |
|---|---|--------------|-----------|-------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 319 | 4897 | Picnic Area | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| | | 320 | 4898 | Picnic Area | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| | | 321 | 4903 | Picnic Area | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| | | 322 | 4963 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Knee clearance, width less than 30 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| | | 323 | 4979 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| D | Y | 324 | 4980 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, width less than 30 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

02-08-2019 Page 54/55





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|----|--------------|-----------|-------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| TA | 325 | 4987 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Clear floor space, width less than 30 inches | 3 | Provide a compliant clear floor space. | Number | 1 | \$1,300 | \$1,300 |
| | 326 | 4989 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Clear floor space, width less than 30 inches | 3 | Provide a compliant clear floor space. | Number | 1 | \$1,300 | \$1,300 |
| | 327 | 5176 | Exterior | Van Accessible Parking Space; 502.6 Identification | Van Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |


Totals for Scotlandville Parkway

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 2) | Design Cost (8% of 1) Project Management (10% of 1) | \$109,245 \$136,556 |
|----|--|------------------------|
| 4) | No Contingency Cost (Historic) | \$0 |
| | Proposed Budget (1+2+3+4) | \$1,611,361 |

02-08-2019 Page 55/55

SEVENTH STREET BATON ROUGE, LA 70802

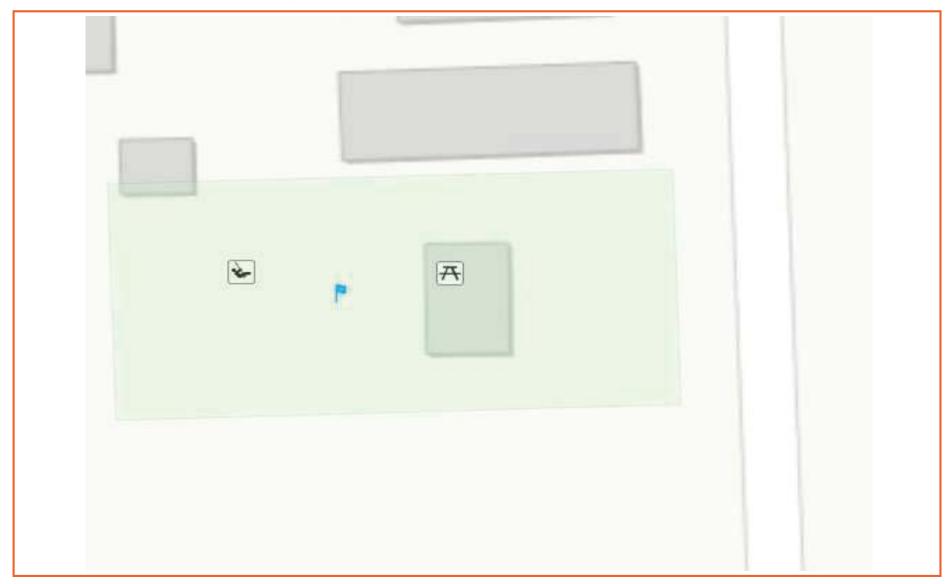

Inspection Date: 5/7/18





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|------------------|---|--|----------|--|--------|----------|-------------------|---------------------------|
| 1 | 3563 | Play Area. Small | Play Ground; 240.2.2 Elevated Play Components | Elevated play components - Minimum number required on accessible route (where provided), less than 50 % | 2 | Replace with compliant play equipment. | Number | 1 | \$75,000 | \$75,000 |
| 2 | 4961 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Seventh Street Park


Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$89,090 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$7,550 |
| 2) | Design Cost (8% of 1) | \$6,040 |
| 1) | Estimated Cost | \$75,500 |

BREC 2018 Park

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

501 SHARP ROAD BATON ROUGE, LA 70815

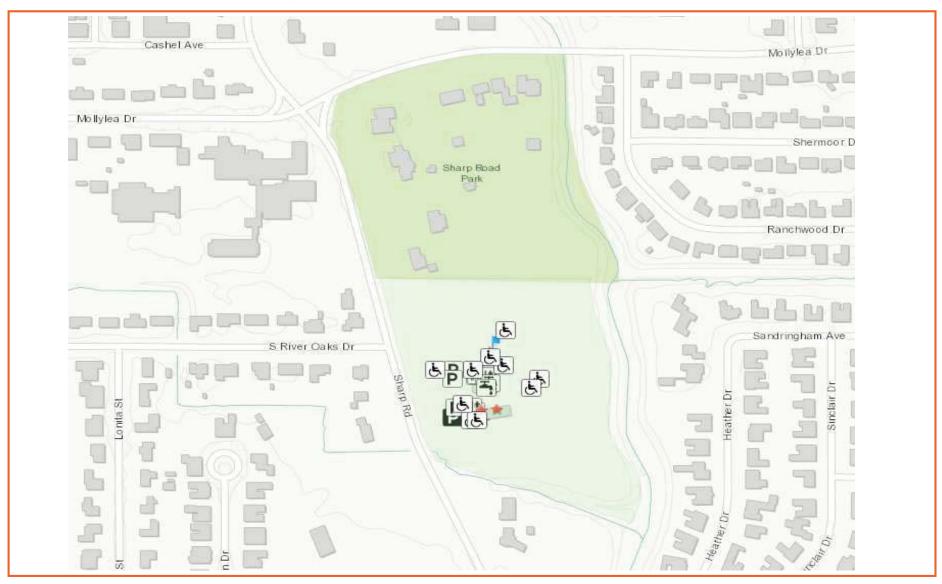

Inspection Date: 7/16/18





| | | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ADA Transitio | n Pian | | | | |
|--------------|-----|--|--|--|------------------|--|-------------|----------|-------------------|---------------------------|
| REPORT ID | GIS | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | 110 | Parking Lot | Accessible Parking Space; 502.3 Access Aisle | Standard Accessible Marked Parking - Access aisle, missing | 1 | Build a compliant access aisle or restripe existing. | Number | 1 | \$1,800 | \$1,800 |
| 2 | 275 | Parking Lot | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |
| 3 | 361 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 120 | \$30 | \$3,600 |
| 4 | 685 | Area of Sport Activity, To Baseball field and dogouts. Both sides. | Accessible Route; 206.2.2 Within a Site | Accessible route missing to both dugouts and into sports field | 1 | Add compliant gate into the dugout. | Number | 2 | \$350 | \$700 |
| 5 | 686 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 50 | \$30 | \$1,500 |
| 6 | 687 | To Baseball field and dugouts from Playground | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 120 | \$30 | \$3,600 |





| | | COCO | | | 2020 : 0:10 0:10 110 | creation in East Baton Rouge Fan | | | | | | |
|---------------------------------------|----|--------------|-----------|-----------------------------------|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | | 7 | 873 | Trail | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 3 | \$200 | \$600 |
| | | 8 | 1734 | Parking Lot | Accessible Route; 403.5.1 Clear Width | Walking surface - Clear width, less than 32 inches | 1 | Rebuild the walking surface to have a compliant clear width. | Linear Feet | 1 | \$30 | \$30 |
| | | 9 | 1802 | Recreation Center | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| N. | | 10 | 1803 | Recreation Center | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| | | 11 | 2032 | Recreation Center, Entrance | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| 22. | ** | 12 | 2589 | Restroom | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |





| | | COCO | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fair | | | | | | |
|----|--|--------------|-----------|--|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| ** | 5 4 | 13 | 2722 | Restroom | Drinking Fountain; 602.2 Clear Floor Space | Drinking Fountain - Clear floor space - Knee clearance, depth (27 inch height) not between 8 and 25 inches | 2 | Replace with a compliant drinking fountain. | Number | 1 | \$2,500 | \$2,500 |
| | | 14 | 2852 | Recreation Center | Miscellaneous Element; 307 Protruding Objects - Counter | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$1,200 | \$1,200 |
| | | 15 | 2913 | Recreation Center, In workroom/class room | Miscellaneous Element; 307 Protruding Objects - Shelf | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$40 | \$40 |
| | R | 16 | 3176 | Center, In | Miscellaneous Element; 308 Reach Ranges - Coat Hook | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$40 | \$40 |
| 1 | The state of the s | 17 | 3199 | Women's restroom | Miscellaneous Element; 308 Reach Ranges - Light switch | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$700 | \$700 |
| | O SACING | 18 | 3207 | Recreation Center | Miscellaneous Element; 308 Reach Ranges - Light switch | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 11 | \$700 | \$7,700 |





| | COO | | | | ereation in East Daton Rouge Fair | | | | | | |
|---|--------------|-----------|-------------------------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| F | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 19 | 3382 | Parking Lot | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| | 20 | 3895 | Men's Restrooms, Playground | Restroom - Lavatory/Sink; 606.3 Height | Lavatory - Rim height, greater than 34 inches | 1 | Relocate the lavatory or replace lavatory. | Number | 1 | \$900 | \$900 |
| | 21 | 3961 | Women's Restrooms, Playground | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| | 22 | 4148 | Women's Restrooms, Playground | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | Replace water closet or relocate to a compliant location. | Number | 1 | \$950 | \$950 |
| | 23 | 4149 | Men's Restrooms, Playground | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | Replace water closet or relocate to a compliant location. | Number | 1 | \$950 | \$950 |
| | 24 | 4313 | Men's Restrooms, Playground | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Extension from the rear wall, less than 54 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-----|--------------|-----------|-------------------------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| | 25 | 4314 | Women's Restrooms, Playground | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Extension from the rear wall, less than 54 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |
| | 26 | 4549 | Men's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| 7 9 | 27 | 4550 | Women's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | 28 | 4610 | Men's Restrooms, Playground | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |

Totals for Sharp Road Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$55,967 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$4,743 |
| 2) | Design Cost (8% of 1) | \$3,794 |
| 1) | Estimated Cost | \$47,430 |





2409 SOUTH MAGNOLIA BAKER, LA 70714



Inspection Date: 5/10/18





| | COUCI | | | 2020 : 01:10 01:0 1:0 | creation in East Baton Roage Fair | | | | | | |
|--|--------------|-----------|---|--|---|----------|--|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 190 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 2 | 490 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 900 | \$30 | \$27,000 |
| | 3 | 491 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | 4 | 3322 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| | 5 | 3620 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | 6 | 3621 | Baseball field | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|------|--------------|-----------|----------------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | 7 | 4511 | Men's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | 8 | 4512 | Women's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| at . | 9 | 4636 | Men's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 10 | 4637 | Women's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 11 | 4981 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |






| REPORT GIS | LOCATIONS BAR | RRIERS; VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|------------|---------------|-------------------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | CC | CODES | | | | | COST | PER ITEM |

Totals for South Magnolia Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$40,260 |
|----|--------------------------------|----------|
| 1) | Estillated Cost | 540,200 |
| 2) | Design Cost (8% of 1) | \$3,221 |
| 3) | Project Management (10% of 1) | \$4,026 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$47,507 |

2101 SPAIN STREET BATON ROUGE, LA 70806

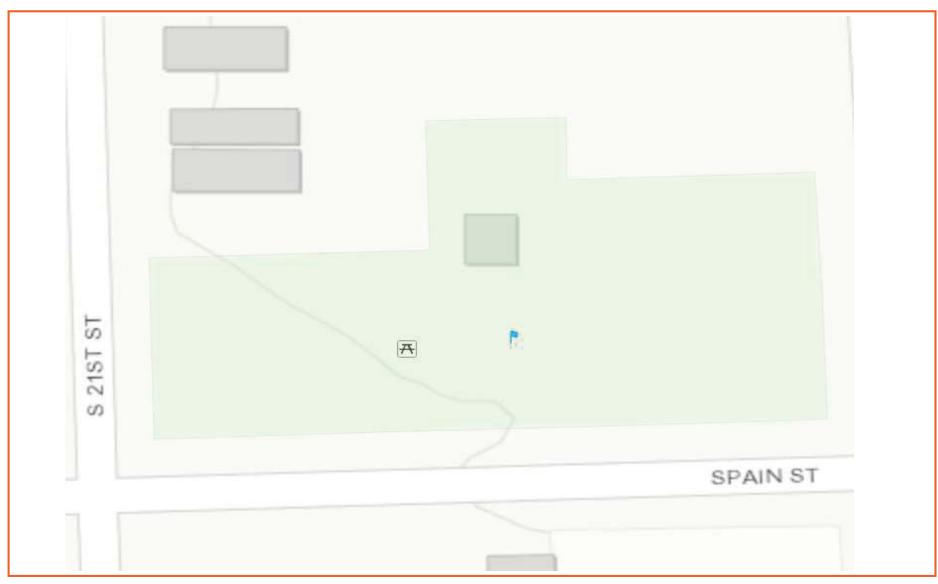

Inspection Date: 5/4/18






| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-------------|--------------------|--|----------|--|--------|----------|-------------------|---------------------------|
| 1 | 4966 | Picnic Area | - | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Spain Street Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$500 |
|----|--------------------------------|-------|
| 2) | Design Cost (8% of 1) | \$40 |
| 3) | Project Management (10% of 1) | \$50 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$590 |

1300 SPANISH TOWN ROAD BATON ROUGE, LA 70802

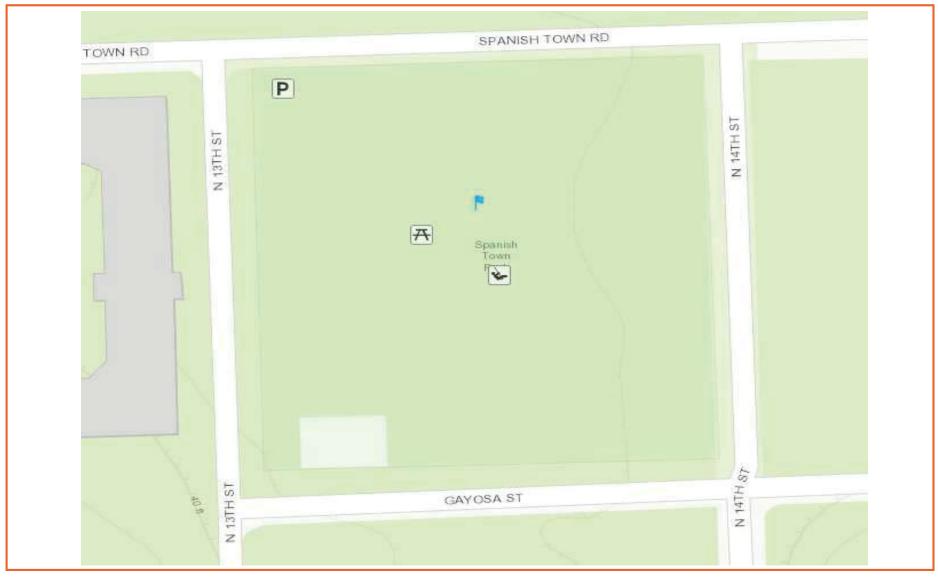

Inspection Date: 5/7/18






| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|--------------|-----------|---------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| | 1 | 3312 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | 2 | 3571 | Play Area. Swing | Playground; 1008.4.4 Entry Points and Seats | Entry Point/Seat - Height, not between 11 and 24 inches | 2 | Replace with a compliant entry point/seat. | Number | 1 | \$3,500 | \$3,500 |
| THE COLD THE | 3 | 4962 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Spanish Town Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$7,198 |
|----|--------------------------------|---------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$610 |
| 2) | Design Cost (8% of 1) | \$488 |
| 1) | Estimated Cost | \$6,100 |

1002 LAUREL STREET BATON ROUGE, LA 70802

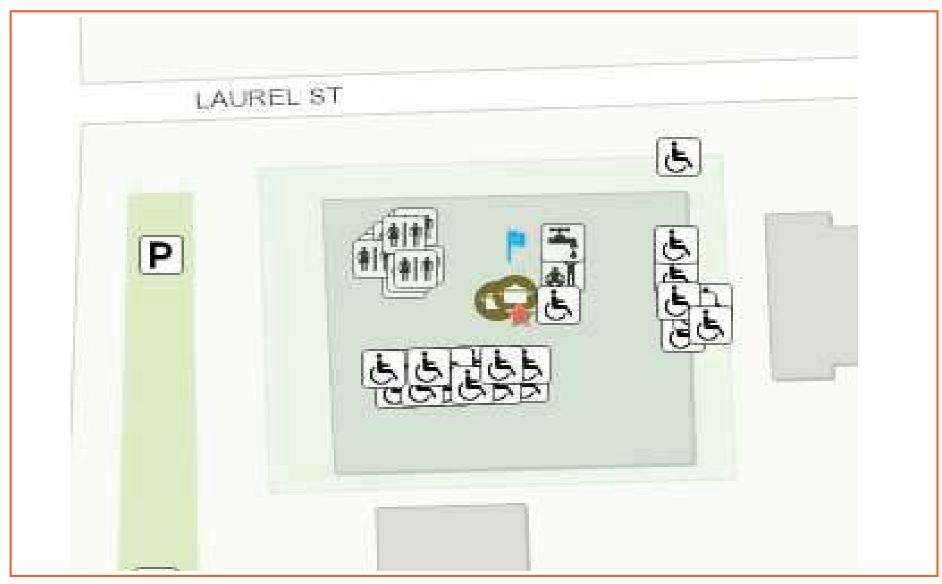

Inspection Date: 6/7/18





| | | 0 | | 2018 Parks and Ke | ecreation in East Baton Rouge Par | ish ADA Transitio | n Plan | | | | |
|---|--------------|-----------|---------------------------------------|--|--|-------------------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 92 | Exterior | Accessible Parking Space; 502.2 Vehicle Spaces | Standard Accessible Marked Parking - Marking, missing | 1 | Provide marking. | Number | 2 | \$300 | \$600 |
| AT LODING | 2 | 108 | Exterior | Accessible Parking Space; 502.3 Access Aisle | Standard Accessible Marked Parking - Access aisle, missing | 1 | Build a compliant access aisle or restripe existing. | Number | 2 | \$1,800 | \$3,600 |
| | 3 | 938 | Kitchen door to Storage | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |
| Sensitive Control of the Control of | 4 | 939 | Hallway door to Gym | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |
| | 5 | 940 | Hallway door to Kitchen | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |
| | 6 | 941 | Hallway door to Mechanical room | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |





| | COCO | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|----|--------------|-----------|----------------------------|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| HT | 7 | 942 | Hallway door to Storage | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |
| | 8 | 1100 | Egress route | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 9 | 1101 | Egress route | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| | 10 | 1102 | Egress from gym | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 1 | \$30 | \$30 |
| | 11 | 1707 | Egress route | Accessible Route; 403.4 Changes in Level | Walking surface - Changes in level, greater than 1/4 inches | 1 | Build a compliant curb ramp. | Number | 1 | \$1,400 | \$1,400 |
| | 12 | 1732 | Egress route from gym | Accessible Route; 403.5.1 Clear Width | Walking surface - Clear width, less than 32 inches | 1 | Rebuild the walking surface to have a compliant clear width. | Linear Feet | 5 | \$30 | \$150 |





| CCACC | | | | | | | | | | |
|--------------|-----------|---|--|---|----------|--|--------|----------|-------------------|---------------------------|
| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 13 | 1735 | Interior | Accessible Route; 403.5.1 Clear Width | Walking surface - Clear width, less than 32 inches | 1 | Relocate the Drinking Fountain to have a compliant width. | Number | 1 | \$3,000 | \$3,000 |
| 14 | 1787 | Hallway between Gym and Classroom | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| 15 | 1788 | Kitchen door to Storage | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| 16 | 1789 | Interior | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| 17 | 1790 | Interior | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| 18 | 1791 | Interior | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |





| | | MACION | | | 2020 : 01:10 0:10 1:10 | ereation in East Daton Rouge Fan | | | | | | |
|-------|--|--------------|-----------|---|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 19 | 1792 | Interior | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| | | 20 | 1793 | Emergency Egress door from the Gym | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| | THE STATE OF THE S | 21 | 1794 | Emergency Egress door from the Gym | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| | 00 | 22 | 1795 | Door from weight room to storage | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 1 | \$2,500 | \$2,500 |
| 6. 11 | | 23 | 2014 | Egress door | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | | 24 | 2077 | Interior ramp from hallway to old abandoned showers | Accessible Route; 405.2 Slope | Ramp - Running slope, greater than 1:12 | 1 | Rebuild the ramp. | Number | 1 | \$7,000 | \$7,000 |





| | | | | ZUIO Paiks aliu ke | creation in East Baton Rouge Pan | SII ADA ITAIISILIO | II FIdII | | | | |
|-----|------------|-----------|-------------------------|--|---|--------------------|--|--------|----------|-------------------|---------------------------|
| RE | PORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| - | 25 | 2552 | Gym | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 26 | 2744 | Interior | Exercise Machines and Equipment; 1004.1 Clear Floor Space | Exercise Machines and Equipment - Clear floor space - Overlap, possibility | 2 | Provide a compliant clear floor space. | Number | 1 | \$200 | \$200 |
| | 27 | 2785 | Kitchen | Kitchen/Kitchenette; 804.4 Sinks | Sink - Rim height, greater than 34 inches | 3 | Relocate or replace sink. | Number | 1 | \$900 | \$900 |
| 300 | 28 | 2798 | Kitchen | Kitchen/Kitchenette; 804.6.4 Range or Cooktop | Appliances - Cooktop - Controls - Location, requires reaching across burners | 3 | Provide a compliant cooktop. | Number | 1 | \$600 | \$600 |
| | 29 | 3231 | Kitchen/Kitchen ette | | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$40 | \$40 |
| | 30 | 3369 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |





| | | COCO | | | 2020 1 01110 0110 110 | cercation in East Daton Rouge Fair | | | | | | |
|-----|-----|--------------|-----------|----------------------|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 105 | | 31 | 3729 | Women's Restrooms | Restroom - Lavatory/Sink Advisory; 606.1 General | Lavatory - Soap dispenser - Height, not between 15 and 48 inches | 3 | Relocate soap dispenser. | Number | 1 | \$40 | \$40 |
| | | 32 | 3818 | Men's Restrooms | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| | | 33 | 3819 | Women's Restrooms | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| | | 34 | 3889 | Women's Restrooms | Restroom - Lavatory/Sink; 606.3 Height | Lavatory - Rim height, greater than 34 inches | 1 | Relocate the lavatory or replace lavatory. | Number | 1 | \$900 | \$900 |
| V | | 35 | 3951 | Men's Restrooms | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| | Ac- | 36 | 3952 | Women's Restrooms | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-----|--------------|-----------|----------------------|---|---|----------|---------------------------------------|--------|----------|-------------------|---------------------------|
| Nd | 37 | 4015 | Women's Restrooms | Restroom - Lavatory/Sink; Advisory 606.1 General | Lavatory - Towel dispenser - Height, not between 15 and 48 inches | 3 | Relocate towel dispenser. | Number | 1 | \$40 | \$40 |
| 9 6 | 38 | 4478 | Women's Restrooms | Restrooms; 213.3.1 Toilet Compartments | Toilet compartment, less than 1 accessible provided | 1 | Build a compliant toilet compartment. | Number | 1 | \$2,800 | \$2,800 |
| Si | 39 | 4479 | Men's Restrooms | Restrooms; 213.3.1 Toilet Compartments | Toilet compartment, less than 1 accessible provided | 1 | Build a compliant toilet compartment. | Number | 1 | \$2,800 | \$2,800 |
| | 40 | 4689 | Men's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| | 41 | 4690 | Women's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-----------|--------------------|-----------|----------|--------------------|------|----------|-------------------|---------------------------|
| | | | | | | | | | | |

Totals for Sports Academy

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 4) 5) | No Contingency Cost (Historic) Proposed Budget (1+2+3+4) | \$0 \$66,882 |
|----------|---|------------------------|
| 3) | Project Management (10% of 1) | \$5,668 |
| 2) | Design Cost (8% of 1) | \$4,534 |
| 1) | Estimated Cost | \$56,680 |



STARWOOD COURT BATON ROUGE, LA 70802



Inspection Date: 5/9/18





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|---------------------------------|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| 1 | 303 | Parking Lot, To Right-of-Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 120 | \$30 | \$3,600 |
| 2 | 3287 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| 3 | 3439 | Play Area. Large | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$8,000 | \$8,000 |
| 4 | 3585 | Parking Lot | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 5 | 4928 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |






| REPORT GIS | LOCATIONS | BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|------------|-----------|-----------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | | CODES | | | | | | COST | PER ITEM |

Totals for Starwood Court Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$14,450 |
|----|--------------------------------|----------|
| 2) | Design Cost (8% of 1) | \$1,156 |
| 3) | Project Management (10% of 1) | \$1,445 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$17,051 |

4700 SUGARLAND DRIVE BATON ROUGE, LA 70814

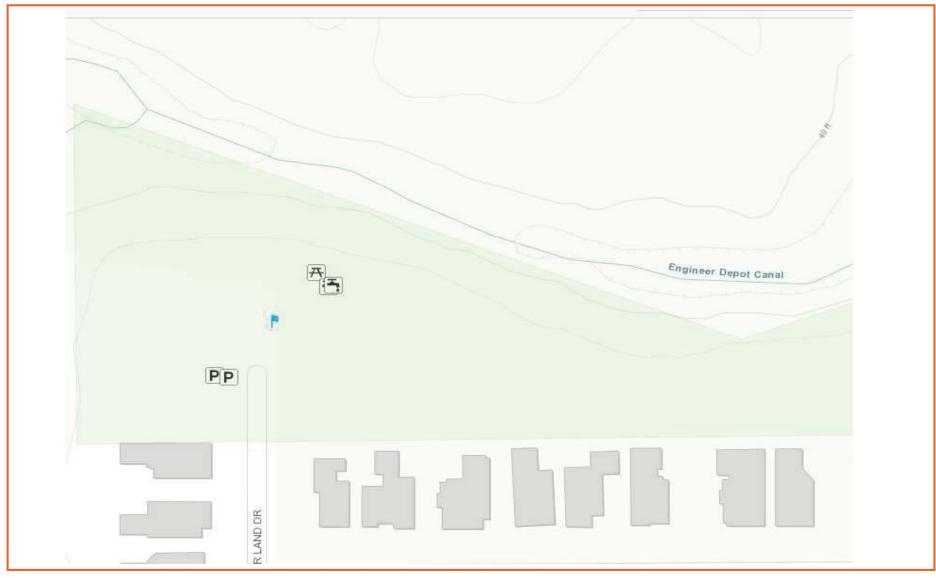

Inspection Date: 5/3/18





| , , , | CORO | | | | | | | | | | |
|-------|--------------|-----------|-------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 179 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |
| 1 | 2 | 2444 | Exterior | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| 1 | 3 | 2636 | Exterior | Drinking Fountain; 307 Protruding Objects | Drinking Fountain - Protruding limits, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Install an apron. | Number | 1 | \$450 | \$450 |
| | 4 | 4956 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| | 5 | 5089 | Exterior | Van Accessible Parking Space; 502.3.1 Width | Van Accessible Marked Parking - Access aisle - Width (with 96 inch van space), less than 96 inches | 1 | Rebuild or restripe the space. | Number | 1 | \$2,100 | \$2,100 |

Page 1/2 02-08-2019





| REPORT GIS | LOCATIONS | BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|------------|-----------|-----------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | | CODES | | | | | | COST | PER ITEM |

Totals for Sugarland Park


Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$5,900 |
|----|--------------------------------|---------|
| 2) | Design Cost (8% of 1) | \$472 |
| 3) | Project Management (10% of 1) | \$590 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$6,962 |

BREC

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

6850 PETIT ROAD BATON ROUGE, LA 70814

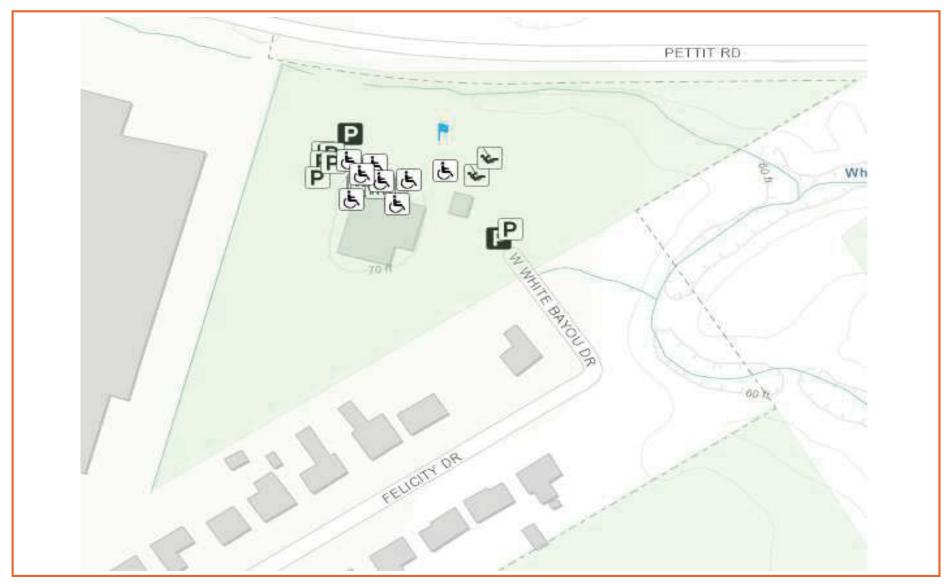

Inspection Date: 7/31/18





| | COUC | | | 2020 : 0:10 0:10 110 | ereation in East Daton Rouge Fan | | | | | | |
|-------|--------------|-----------|--------------|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 99 | Exterior | Accessible Parking Space; 502.3 Access Aisle | Standard Accessible Marked Parking - Access aisle, missing | 1 | Build a compliant access aisle or restripe existing. | Number | 1 | \$1,800 | \$1,800 |
| | 2 | 100 | Exterior | Accessible Parking Space; 502.3 Access Aisle | Standard Accessible Marked Parking - Access aisle, missing | 1 | Build a compliant access aisle or restripe existing. | Number | 1 | \$1,800 | \$1,800 |
| | 3 | 182 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| 8 101 | 4 | 183 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 5 | 481 | Egress doors | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | 6 | 1021 | Path | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |





| | | 0 | | 2018 Parks and Re | ecreation in East Baton Rouge Pari | sn ADA Transitio | n Plan | | | | |
|---|--------------|-----------|-----------------------------------|--|---|------------------|---|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 1291 | Parking Lot | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 20 | \$30 | \$600 |
| | 8 | 1292 | Recreation Center, Entrance | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 9 | 1293 | Path nearby Parking Lot | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 10 | \$30 | \$300 |
| 1 | 10 | 1830 | Women's Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Push, hinge side approach, less than 48 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 11 | 1831 | Men's Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Push, hinge side approach, less than 48 inches (perpendicular to doorway) for door with closer and latch | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| W | 12 | 1877 | Classrooms | Accessible Route; 404.2.4.3 Recessed Doors and Gates | Door, recessed - Maneuvering clearance, recessed more than 8 inches | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |





| 1000 | adol | | | 2020 : 01:10 0:10 1:10 | ereation in East Daton Rouge Fair | | | | | | |
|------|-------------|-----------|-----------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 13 | 2453 | Interior | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 14 | 2720 | Interior | Drinking Fountain; 602.2 Clear Floor Space | Drinking Fountain - Clear floor space - Knee clearance, height less than 27 inches | 2 | Replace with a compliant drinking fountain. | Number | 1 | \$2,500 | \$2,500 |
| | 15 | 3272 | Exterior | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 4 (for parking space range 76 - 100) | 1 | Build 1 accessible parking space and 1 van accessible parking space. | Number | 2 | \$2,100 | \$4,200 |
| | 16 | 3379 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | 17 | 3534 | Play Area | Play Ground; 1008.3.2.3 Transfer Supports | Transfer steps - Means of support, missing | 2 | Replace Transfer system. | Number | 1 | \$3,500 | \$3,500 |
| + | 18 | 3573 | Play Area | Playground; 1008.4.4 Entry Points and Seats | Entry Point/Seat - Height, not between 11 and 24 inches | 2 | Replace with a compliant entry point/seat. | Number | 1 | \$3,500 | \$3,500 |





| | | | | | 2020 : 0:10 0:10 110 | creation in East Baton Rouge Fair | 31171271 1141131610 | | | | | |
|----|------|---|-----------|----------------------|---|---|---------------------|---|--------|----------|-------------------|---------------------------|
| | REPO | | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 1 | | 9 | 4072 | Men's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 603.4 Coat Hooks and Shelves | Coat hook - Height, greater than 48 inches | 3 | Relocate coat hook. | Number | 1 | \$40 | \$40 |
| A. | 3 | 0 | 4073 | Women's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 603.4 Coat Hooks and Shelves | Coat hook - Height, greater than 48 inches | 3 | Relocate coat hook. | Number | 1 | \$40 | \$40 |
| | 9 | 1 | 4108 | Men's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | Replace water closet or relocate to a compliant location. | Number | 1 | \$950 | \$950 |
| | | 2 | 4448 | Men's Restrooms | Restrooms - Wheelchair/Ambula tory Accessible Water Closet; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull - Hinge side approach, less than 42 inches (parallel to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$3,500 | \$3,500 |
| | | 3 | 4449 | Women's Restrooms | Restrooms - Wheelchair/Ambula tory Accessible Water Closet; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull - Hinge side approach, less than 42 inches (parallel to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$3,500 | \$3,500 |
| | 9 | 4 | 4581 | Men's Restrooms | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|----------------------|--------------------------------|---|----------|----------------------------|--------|----------|-------------------|---------------------------|
| 25 | 4762 | Women's Restrooms | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| 26 | 4763 | Men's Restrooms | | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |

Totals for T.D. Bickham, Jr. Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$67,413 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$5,713 |
| 2) | Design Cost (8% of 1) | \$4,570 |
| 1) | Estimated Cost | \$57,130 |

11600 TAMS DRIVE BATON ROUGE, LA 70815



Inspection Date: 5/3/18





| | CCCCC | | | | 9 | | | | | | |
|-----|--------------|-----------|---|--|---|----------|--|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 774 | 1 | 177 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 2 | 315 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 140 | \$30 | \$4,200 |
| | 3 | 455 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 150 | \$30 | \$4,500 |
| | 4 | 456 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 20 | \$30 | \$600 |
| | 5 | 2442 | Exterior | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 6 | 3304 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-----|--------------|-----------|----------------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | 7 | 3871 | Women's Restrooms | Restroom - Lavatory/Sink; 606.3 Height | Lavatory - Rim height, greater than 34 inches | 1 | See item 8. | Number | 1 | \$0 | \$0 |
| e i | 8 | 4508 | Men's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Replace modular restroom building. | Number | 1 | \$80,000 | \$80,000 |
| | 9 | 4629 | Men's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | See item 8. | Number | 1 | \$0 | \$0 |
| | 10 | 4630 | Women's Restrooms | Restrooms; 703.1 General | Sign - Missing | 2 | See item 8. | Number | 1 | \$0 | \$0 |
| | 11 | 4952 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |






| REPORT GIS LC | OCATIONS BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|---------------|--------------------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | CODES | | | | | | COST | PER ITEM |

Totals for Tams Drive Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$94,440 |
|----|--------------------------------|-----------|
| 2) | Design Cost (8% of 1) | \$7,555 |
| 3) | Project Management (10% of 1) | \$9,444 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$111,439 |

700 TERRACE STREET BATON ROUGE, LA 70802

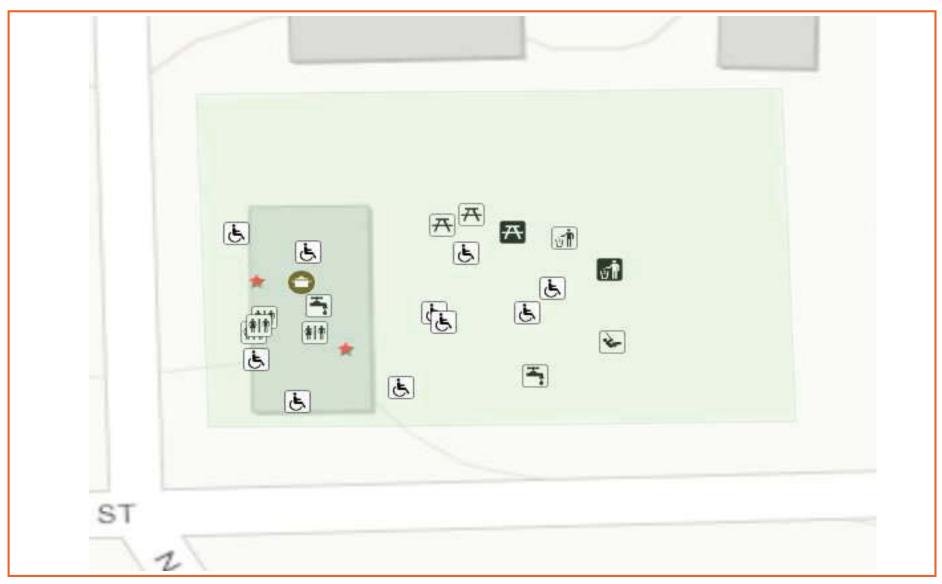

Inspection Date: 8/1/18





| | | COCIOI | | | | 0 | | | | | | |
|--|----------------|--------------|-----------|---|--|--|----------|--|-------------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 1 | 495 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 15 | \$30 | \$450 |
| | | 2 | 496 | Area of Sport Activity, To Assembly Area | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 10 | \$30 | \$300 |
| | | 3 | 497 | Area of Sport Activity, To Garden beds | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 10 | \$30 | \$300 |
| pres ha l'amon de l'amon d | | 4 | 897 | Recreation Center | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 7 | \$500 | \$3,500 |
| | | 5 | 1324 | Recreation Center | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| WOI | NEN CONTRACTOR | 6 | 1759 | Recreation Center | Accessible Route; 404.2.3 Clear Width | Door - Opening clear width, less than 32 inches | 1 | Rebuild door opening to have opening clear width of 32 inches or more. | Number | 8 | \$2,500 | \$20,000 |





| | COUCI | | | 2020 : 01:10 0:10 1:10 | creation in East Daton Rouge Fan | | | | | | |
|--|--------------|-----------|--|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 1834 | Recreation Center, Men's Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, front approach, less than 18 inches (parallel to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 8 | 2000 | Recreation Center, Back yard door | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| \$ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ | 9 | 2001 | Recreation Center | Accessible Route; 404.2.5 Thresholds | Door - Threshold height, greater than 1/2 inches | 1 | Replace with compliant threshold. | Number | 1 | \$2,000 | \$2,000 |
| | 10 | 2065 | Recreation Center | Accessible Route; 405.2 Slope | Ramp - Running slope, greater than 1:12 | 1 | Rebuild the ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 11 | 2457 | Recreation Center | Drinking Fountain; 211.2 Minimum Number | Minimum number required, less than 2 | 2 | Provide an additional drinking fountain, ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 12 | 2766 | Recreation Center | Kitchen/Kitchenette; 804.3.1 Clear Floor or Ground Space | Multiple Violations | 3 | Rebuild the kitchen. | Number | 1 | \$20,000 | \$20,000 |





| | MACION | | | | creation in East Baton Rouge Fair | | | | | | |
|---|--------------|-----------|---|---|---|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| S. C. | 13 | 3183 | Recreation Center, In office | Miscellaneous Element; 308 Reach Ranges - Fire Extinguisher | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$60 | \$60 |
| | 14 | 3469 | Play Area. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$6,000 | \$6,000 |
| | 15 | 3623 | Area of Sport Activity | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| 1 | 16 | 3782 | Men's Restrooms, Recreation Center | Restroom - Lavatory/Sink; 603.3 Mirrors | Lavatory - Mirror above lavatory - Height, greater than 40 inches to the bottom edge | 3 | Relocate mirror. | Number | 1 | \$60 | \$60 |
| | 17 | 4114 | Men's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | Replace water closet or relocate to a compliant location. | Number | 1 | \$950 | \$950 |
| | 18 | 4180 | Women's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|----|--------------|-----------|---|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | 19 | 4334 | Men's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Length, less than 42 inches | 1 | Replace with a compliant side grab bar. | Number | 1 | \$450 | \$450 |
| To | 20 | 4345 | Men's Restrooms, Recreation Center | Restrooms - Wheelchair Accessible Water Closet; 604.5.2 Rear Wall | Wheelchair Accessible Water closet - Rear grab bar - Extension from water closet centerline, less than 12 (one side) | 1 | Relocate rear grab bar. | Number | 1 | \$250 | \$250 |
| | 21 | 4894 | Area of Sport Activity | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| | 22 | 5035 | Area of Sport Activity | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Terrace Street Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$96,984 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$8,219 |
| 2) | Design Cost (8% of 1) | \$6,575 |
| 1) | Estimated Cost | \$82,190 |





3451 THIRTY NINTH STREET ZACHARY, LA 70791



Inspection Date: 5/7/18





| | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ada Transitio | n Pian | | | | |
|---|--------|-----------|--|--|---|------------------|-------------------------------------|-------------|----------|-------------------|---------------------------|
| F | REPORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 7 | 1 | 171 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 2 | 311 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 500 | \$30 | \$15,000 |
| | 3 | 426 | Area of Sport Activity, To Tennis courts | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 120 | \$30 | \$3,600 |
| | 4 | 427 | Area of Sport Activity, To Baseball field and dugouts | Accessible Route; 206.2.2 Within a Site | Accessible route missing to both dugouts and into sports field | 1 | Add compliant gate into the dugout. | Number | 2 | \$350 | \$700 |
| | 5 | 676 | Play Area | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 60 | \$30 | \$1,800 |
| | 6 | 887 | Men's Restrooms | Accessible Route; 309.4 Operation | Door - Hardware - Operation, not operable with one hand | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |





| | MACION | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|--|--------------|-----------|----------------------|---|--|----------|---|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 888 | Women's Restrooms | Accessible Route; 309.4 Operation | Door - Hardware - Operation, not operable with one hand | 1 | Replace hardware. | Number | 1 | \$500 | \$500 |
| | 8 | 1819 | Men's Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Push, front approach, less than 48 inches (perpendicular to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 9 | 1820 | Women's Restrooms | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Push, front approach, less than 48 inches (perpendicular to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |
| | 10 | 2213 | Exterior | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 2 (for seating range 26 - 50) | 2 | Rebuild or relocate seats to provide a compliant number of wheelchair spaces. | Number | 2 | \$1,300 | \$2,600 |
| | 11 | 2214 | Exterior | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 2 (for seating range 26 - 50) | 2 | Rebuild or relocate seats to provide a compliant number of wheelchair spaces. | Number | 2 | \$1,300 | \$2,600 |
| | 12 | 2336 | Exterior | Check-Out Aisles/Sales/Service Counters; 904.3.2 Counter | Check-Out Aisles - Counter - Height, greater than 38 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |





| | | UUU | | | 2020 : 0:10 0:10 1:0 | creation in East Baton Rouge Fair | | | | | | |
|---|---|-------------|-----------|----------------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| | R | EPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| T | | 13 | 2436 | Exterior | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| T | | 14 | 2692 | Exterior | Drinking Fountain; 602.2 Clear Floor Space | Drinking Fountain - Clear floor space - Knee clearance, depth (27 inch height) not between 8 and 25 inches | 2 | Replace with a compliant drinking fountain. | Number | 1 | \$2,500 | \$2,500 |
| | | 15 | 2816 | Exterior | Miscellaneous Element; 206.2.2 Within a site - Little library | Miscellaneous Element - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | | 16 | 3188 | Men's Restrooms | Miscellaneous Element; 308 Reach Ranges - Light switch | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$700 | \$700 |
| | | 17 | 3189 | Women's Restrooms | Miscellaneous Element; 308 Reach Ranges - Light switch | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$700 | \$700 |
| | | 18 | 3298 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |





| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|---|--------------|-----------|----------------------|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | 19 | 3504 | Play Area | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$1,500 | \$1,500 |
| | 20 | 3592 | Play Area | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| O | 21 | 4170 | Men's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| B | 22 | 4171 | Women's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | 23 | 4945 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |





| | S BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|-------|-------------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | CODES | | | | | | COST | PER ITEM |

Totals for Thirty-Ninth Street Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$57,740 |
|----|--------------------------------|----------|
| 2) | Design Cost (8% of 1) | \$4,619 |
| 3) | Project Management (10% of 1) | \$5,774 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$68,133 |





8200 OAKVIEW BATON ROUGE, LA 70814



Inspection Date: 5/3/18





| | | | | | creation in East Baton Rouge Fan | | | | | | |
|--|-----|-----------|---|--|---|----------|----------------------------|-------------|----------|-------------------|---------------------------|
| | ORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 202 | Exterior | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 2 | 331 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | 3 | 505 | Area of Sport Activity, To volleyball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 780 | \$30 | \$23,400 |
| | 4 | 506 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 700 | \$30 | \$21,000 |
| | 5 | 511 | Area of Sport Activity, To Baseball field | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 225 | \$30 | \$6,750 |
| | 6 | 512 | Area of Sport Activity, To Tennis court | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 120 | \$30 | \$3,600 |





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-----------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| 7 | 3343 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| 8 | 3631 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |


Totals for Thomas Maher Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$70,965 |
|----|--------------------------------|----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$6,014 |
| 2) | Design Cost (8% of 1) | \$4,811 |
| 1) | Estimated Cost | \$60,140 |



5209 TRISTIAN AVENUE BAKER, LA 70714

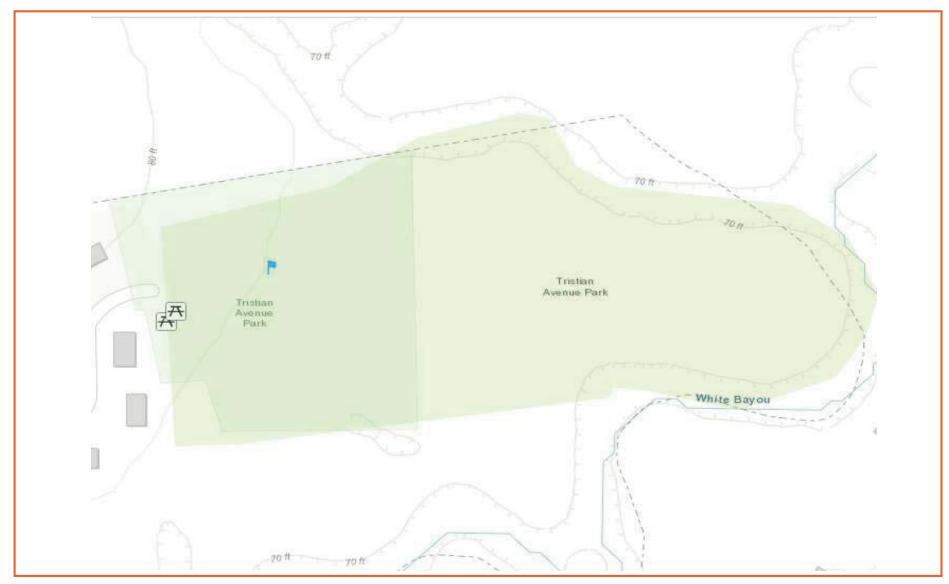

Inspection Date: 5/2/18





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| 1 | 4891 | Picnic Area | Table; 206.2.2 Within a site | Table - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$120 | \$120 |
| 2 | 4947 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Tristian Avenue Park


Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$620 |
|----|--------------------------------|-------|
| 2) | Design Cost (8% of 1) | \$50 |
| 3) | Project Management (10% of 1) | \$62 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$732 |





4200 TUSCARORA STREET BATON ROUGE, LA 70805

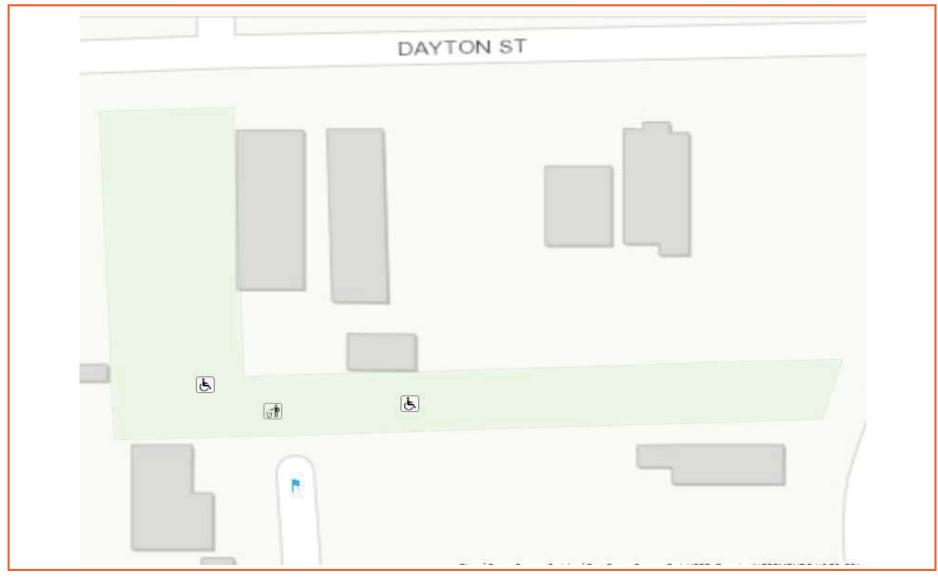

Inspection Date: 5/7/18





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-----------|--------------------------------------|---|----------|---|-------------|----------|-------------------|---------------------------|
| 1 | 1288 | Trail | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 500 | \$30 | \$15,000 |
| 2 | 1289 | Trail | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| 3 | 3614 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |

Totals for Tuscarora Street Park


Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$22,250 |
|----|--------------------------------|----------|
| 2) | Design Cost (8% of 1) | \$1,780 |
| 3) | Project Management (10% of 1) | \$2,225 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$26,255 |





2700 TROTTER DRIVE BATON ROUGE, LA 70814

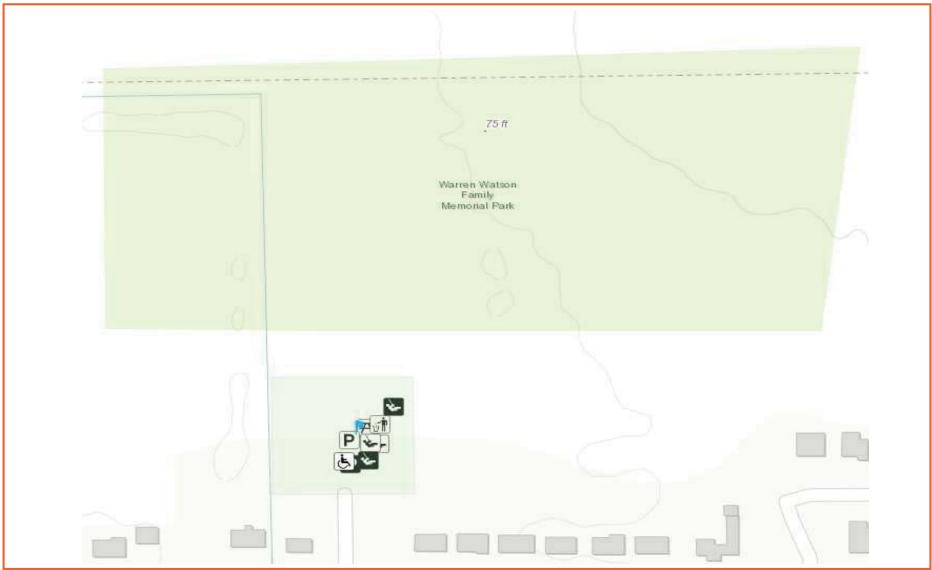

Inspection Date: 5/2/18





| | 1000 | | | | | 0 | | | | | | |
|--|------|-----|-----------|---------------------|--|---|----------|--|-------------|----------|-------------------|---------------------------|
| | | ORT | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | P | 1 | 312 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | | 2 | 3299 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| Ġ. | | 3 | 3449 | Play Area. Small | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 3 | \$4,000 | \$12,000 |
| | | 4 | 3536 | Play Area. Small | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$75,000 | \$75,000 |
| | | 5 | 3593 | Exterior | Receptacle; 206.2.2 Within a site | Receptacle - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| Paris Contraction of the Contrac | | 6 | 4948 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |





| REPORT GIS | LOCATIONS BAR | RRIERS; VIOLATION | I PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|------------|---------------|-------------------|------------|--------------------|------|----------|-----------|---------------|
| ID ID | CC | CODES | | | | | COST | PER ITEM |

Totals for Warren O. Watson Family Memorial Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$92,850 |
|----|--------------------------------|-----------|
| 2) | Design Cost (8% of 1) | \$7,428 |
| 3) | Project Management (10% of 1) | \$9,285 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$109,563 |





1351 COUNTRY CLUB DRIVE BATON ROUGE, LA 70806



Inspection Date: 7/19/18







Historic

| | OCOCIO | | | | | | | | | | |
|---|--------------|-----------|--|--|---|----------|------------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 1 | 294 | Playground | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 2 | 295 | Parking for golf course building. | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs, missing | 1 | Provide identification sign. | Number | 1 | \$350 | \$350 |
| | 3 | 296 | Parking for golf course building. | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 4 | 297 | Parking for golf course building. | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 5 | 368 | From Right-of- Way to both senior center and fitness center. | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 250 | \$30 | \$7,500 |
| 0 | 6 | 712 | To 5 separate buildings of maintenance complex | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 140 | \$30 | \$4,200 |



Historic

| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|---|--------------|-----------|------------------------------|--|--|----------|---|-------------|----------|-------------------|---------------------------|
| | 7 | 713 | To Restrooms on course | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 130 | \$30 | \$3,900 |
| 0 | 8 | 765 | To Restrooms | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 150 | \$30 | \$4,500 |
| * | 9 | 971 | Maintenance building door | Accessible Route; 309.4 Operation | Door - Hardware - Operation, twisting of the wrist required | 1 | Replace hardware. | Number | 2 | \$500 | \$1,000 |
| | 10 | 1684 | Play Area | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 15 | \$30 | \$450 |
| | 11 | 1685 | Parking Lot | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |
| | 12 | 1686 | Parking Lot | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 30 | \$30 | \$900 |





Webb Memorial Park And Golf Course

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

Historic

| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-------|--------------|-----------|--|---|---|----------|---|-------------|----------|-------------------|---------------------------|
| and . | 13 | 1687 | To Restrooms | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 25 | \$30 | \$750 |
| | 14 | 1688 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 15 | 1689 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| i | 16 | 1722 | Fitness Center | Accessible Route; 403.4 Changes in Level | Walking surface - Changes in level, greater than 1/4 inches | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| P-5-4 | 17 | 1749 | Golf Center Women's Restrooms | Accessible Route; 404.2.2 Double-Leaf Doors and Gates | Door - Type, both of the leaves on a double-leaf door do not follow requirements | 1 | Replace door with compliant type. | Number | 1 | \$2,500 | \$2,500 |
| | 18 | 1845 | Men's Restrooms in Fitness center. | Accessible Route; 404.2.4.1 Swinging Doors and Gates | Door - Maneuvering clearance - Pull, front approach, less than 18 inches (parallel to doorway) | 1 | Provide door maneuvering clearance. | Number | 1 | \$5,000 | \$5,000 |





Webb Memorial Park And Golf Course

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

Historic

| | COICIOI | | | | | | | | | | |
|---|--------------|-----------|----------------------------|---|---|----------|---|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 19 | 1984 | Senior Center Restrooms | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |
| 1 | 20 | 1985 | Exterior | Accessible Route; 404.2.4.4 Floor or Ground Surface | Door, doorway - Maneuvering clearance, floor or ground surface, slope greater than 1:48 | 1 | Rebuild the maneuvering clearance to have slope less than 1:48. | Number | 1 | \$5,000 | \$5,000 |
| | 21 | 2094 | Exterior | Accessible Route; 405.2 Slope | Ramp - Running slope, greater than 1:12 | 1 | Rebuild the ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 22 | 2095 | Exterior | Accessible Route; 405.2 Slope | Ramp - Running slope, greater than 1:12 | 1 | Rebuild the ramp. | Number | 1 | \$7,000 | \$7,000 |
| | 23 | 2104 | Exterior | Accessible Route; 405.7 Landings | Ramp - Bottom landing, missing | 1 | Provide bottom landing. | Number | 1 | \$1,500 | \$1,500 |
| | 24 | 2122 | Play Area | Accessible Route; 405.8 Handrails | Ramp - Handrails - Missing on rump run with rise greater than 6 inches | 1 | Install compliant handrails on both sides. | Number | 1 | \$3,200 | \$3,200 |







Historic

| * | | CORTO | | | | | | | | | | |
|---|---|--------------|-----------|--|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 25 | 2155 | Fitness Center | Accessible Route; 505.10.1 Top and Bottom Extension at Ramps | Ramp - Handrails - Extension on ramps, length less then 12 inches beyond the top ramp run in the direction of the ramp run | 1 | Provide compliant handrails. | Number | 1 | \$3,200 | \$3,200 |
| | 3 | 26 | 2156 | Fitness Center | Accessible Route; 505.10.1 Top and Bottom Extension at Ramps | Ramp - Handrails - Extension on ramps, length less then 12 inches beyond the top ramp run in the direction of the ramp run | 1 | Provide compliant handrails. | Number | 1 | \$3,200 | \$3,200 |
| | | 27 | 2363 | Fitness center | Check-Out Aisles/Sales/Service Counters; 904.4.1 Parallel Approach | Sales/Service Counters - Parallel approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |
| | | 28 | 2386 | Golf pro shop. | Check-Out Aisles/Sales/Service Counters; 904.4.2 Forward Approach | Sales/Service Counters - Forward approach - Counter - Height, greater than 36 inches | 3 | Provide compliant counter. | Number | 1 | \$2,400 | \$2,400 |
| | | 29 | 2415 | Fitness | Dressing Rooms; 903.2 Clear Floor or Ground Space | Dressing Rooms - Bench - Clear floor space - Width, less than 30 inches | 3 | Provide compliant clear floor space. | Number | 1 | \$3,700 | \$3,700 |
| | | 30 | 2569 | Between fitness center and golf shop | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |







Historic

| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|---|--------------|-----------|---------------------------|--|--|----------|--|--------|----------|-------------------|---------------------------|
| 3 | 31 | 2570 | Fitness Center | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 32 | 2626 | Exterior | Drinking Fountain; 211.2 Minimum Number | Minimum number required, less than 2 | 2 | Provide an additional drinking fountain, ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 33 | 2627 | Play Area | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 34 | 2730 | Play Area | Drinking Fountain; 602.2 Clear Floor Space | Drinking Fountain - Clear floor space - Length, less than 48 inches | 2 | Provide a compliant clear floor space. | Number | 1 | \$1,300 | \$1,300 |
| | 35 | 2818 | Exterior | Miscellaneous Element; 206.2.2 Within a site - Water Cooler | Miscellaneous Element - Accessible route, missing | 3 | Relocate on an accessible route. | Number | 1 | \$250 | \$250 |
| | 36 | 3159 | Playground by parking lot | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |







Historic

| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-------|--------------|-----------|---|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | 37 | 3160 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 38 | 3161 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| VSIA. | 39 | 3162 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 40 | 3163 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| | 41 | 3174 | Women's Restrooms next to playground | Miscellaneous Element; 308 Reach Ranges - Coat Hook | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$40 | \$40 |
| | 42 | 3175 | Men's Restrooms next to playground | Miscellaneous Element; 308 Reach Ranges - Coat Hook | Reach range, not between 15 and 48 inches | 3 | Relocate or replace element to include all operable parts within a compliant reach range. | Number | 1 | \$40 | \$40 |







Historic

| - | | CORTO | | | | | | | | | | |
|---|---|--------------|-----------|--|---|---|----------|--|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 43 | 3388 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | | 44 | 3399 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Replace 1 standard accessible parking space with 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| | | 45 | 3409 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| | J | 46 | 3966 | Women's Restrooms. Maintenance Yard | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | See item 51. | Number | 1 | \$0 | \$0 |
| | | 47 | 3974 | Men's Restrooms, Golf shop. | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| 9 | | 48 | 4233 | Women's Restrooms, Golf pro shop | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |





Webb Memorial Park And Golf Course

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

Historic

| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-----|--------------|-----------|--|---|---|----------|------------------------------------|--------|----------|-------------------|---------------------------|
| | 49 | 4331 | Men's Restrooms, Pro shop | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Extension from the rear wall, less than 54 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |
| 1.0 | 50 | 4332 | Men's Restrooms, Pro shop | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Extension from the rear wall, less than 54 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |
| | 51 | 4556 | Men's Restrooms. Maintenance Yard | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Replace modular restroom building. | Number | 1 | \$80,000 | \$80,000 |
| | 52 | 4557 | Men's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Replace modular restroom building. | Number | 1 | \$80,000 | \$80,000 |
| | 53 | 4558 | Women's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | See item 52. | Number | 1 | \$0 | \$0 |
| 7 | 54 | 4559 | Women's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Replace modular restroom building. | Number | 1 | \$80,000 | \$80,000 |





Webb Memorial Park And Golf Course

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

Historic

| | REPOR ID | | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|---|-------------|------|--|------------------------------------|--|----------|--|--------|----------|-------------------|---------------------------|
| | 55 | 4560 | Men's Restrooms | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | See item 54. | Number | 1 | \$0 | \$0 |
| 0 | 56 | 4570 | Men's Restrooms, Fitness center | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | 57 | 4571 | Women's Restrooms, Fitness Center | Restrooms; 603.2.2 Overlap | Clearance - Overlap, one or more elements overlaps the required clearance. | 1 | Rebuild the restroom to have compliant clearances. | Number | 1 | \$3,500 | \$3,500 |
| | 58 | 4618 | Men's Restrooms, Senior center and playground. | Restrooms; 604.6 Flush Controls | Wheelchair Accessible Water Closet - Flush control - Location, wrong side of water closet | 1 | Replace the water closet. | Number | 1 | \$950 | \$950 |
| | 59 | 4719 | Men's Restrooms. Maintenance Yard | Restrooms; 703.1 General | Sign - Missing | 2 | See item 51. | Number | 1 | \$0 | \$0 |
| 1 | 60 | 4720 | Women's Restrooms. Maintenance Yard | Restrooms; 703.1 General | Sign - Missing | 2 | See item 51. | Number | 1 | \$0 | \$0 |







Historic

| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|-----|-----------|-----------|--|--|--|----------|--|--------|----------|-------------------|---------------------------|
| B | 61 | 4741 | Men's Restrooms, Fitness Center | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| 0 4 | 62 | 4742 | Men's Restrooms, Golf shop. | Restrooms; 703.1 General | Sign - Missing | 2 | Install compliant signage. | Number | 1 | \$60 | \$60 |
| M | 63 | 4807 | Men's Restrooms, Sr center/playgrou nd | Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| | 64 | 4808 | Women's Restrooms, Senior center/playgrou nd | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | Provide compliant signage. | Number | 1 | \$60 | \$60 |
| | 65 | 4863 | Interior | Storage/Lockers; 225.2 Storage | Storage, less than 5% (or less than 1) of each type | 3 | Provide at least 5% accessible storage. | Number | 1 | \$600 | \$600 |
| | 66 | 5057 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |





Webb Memorial Park And Golf Course

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

Historic

| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-------------|--|---|----------|--|--------|----------|-------------------|---------------------------|
| 67 | 5058 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, width less than 30 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |

Totals for Webb Memorial Park And Golf Course

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$369,360 |
|----|----------------------------------|-----------|
| 2) | Design Cost (8% of 1) | \$29,549 |
| 3) | Project Management (10% of 1) | \$36,936 |
| 4) | Contingency (Historic, 11% of 1) | \$40,630 |
| 5) | Proposed Budget (1+2+3+4) | \$476,474 |





4500 EAST BROOKSTOWN BATON ROUGE, LA 70805



Inspection Date: 5/3/18





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-----------------------------|---|---|----------|--|-------------|----------|-------------------|---------------------------|
| 1 | 321 | To Right-of- Way | Accessible Route; 206.2.1 Site Arrival Points | Access from public streets missing | 1 | Build an accessible route. | Linear Feet | 70 | \$30 | \$2,100 |
| 2 | 473 | Play Area, To Playground | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 15 | \$30 | \$450 |
| 3 | 3314 | Parking Lot | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |
| 4 | 3466 | Play Area. Medium | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$6,000 | \$6,000 |
| 5 | 4969 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |





| REPORT GIS LOCA | CATIONS BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|-----------------|-------------------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | CODES | | | | | | COST | PER ITEM |

Totals for West Brookstown Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$11,150 |
|----|--------------------------------|----------|
| 2) | Design Cost (8% of 1) | \$892 |
| 3) | Project Management (10% of 1) | \$1,115 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$13,157 |

BREC

2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

16600 WOODLAWN ACRES AVENUE BATON ROUGE, LA 70817



Inspection Date: 5/2/18





| | COCO | | | | O O | | | | | | |
|-----|--------------|-----------|--|--|---|----------|----------------------------|-------------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| m - | 1 | 120 | Parking space 2 | Accessible Parking Space; 502.3.3 Marking | Standard Accessible Marked Parking - Access aisle - Marking, missing | 1 | Provide marking. | Number | 1 | \$300 | \$300 |
| m | 2 | 121 | Parking space 1 | Accessible Parking Space; 502.3.3 Marking | Standard Accessible Marked Parking - Access aisle - Marking, missing | 1 | Provide marking. | Number | 1 | \$300 | \$300 |
| m | 3 | 167 | Parking space 2 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| m | 4 | 168 | Parking space 1 | Accessible Parking Space; 502.6 Identification | Standard Accessible Marked Parking - Identification signs - Height, less than 60 inches | 1 | Adjust sign height. | Number | 1 | \$40 | \$40 |
| | 5 | 409 | Area of Sport Activity, Baseball field 1 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 250 | \$30 | \$7,500 |
| | 6 | 410 | Area of Sport Activity, Baseball Field 2 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 300 | \$30 | \$9,000 |





| | COO. | | | | creation in East Baton Roage Fair | | | | | | |
|------|--------------|-----------|----------------------------|---|--|----------|---|-------------|----------|-------------------|---------------------------|
| F | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 411 | Play Area, Playground 2 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 50 | \$30 | \$1,500 |
| | 8 | 412 | Play Area, Playground 1 | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 100 | \$30 | \$3,000 |
| | 9 | 413 | Restroom | Accessible Route; 206.2.2 Within a Site | Access to other facilities on the site, missing | 1 | Build an accessible route. | Linear Feet | 230 | \$30 | \$6,900 |
| | 10 | 3250 | Exterior | Minimum Number | Standard accessible minimum number required, less than 4 (for parking space range 76 - 100) | 1 | Build 1 standard accessible parking space and 1 van accessible parking space. | Number | 2 | \$2,100 | \$4,200 |
| | 11 | 3443 | Playground 2 | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$6,000 | \$6,000 |
| en . | 12 | 3444 | Playground 1 | | Ground surface - Maintenance - Type of surface, not compliant | 2 | Replace with compliant ground surface. | Number | 1 | \$6,000 | \$6,000 |





| | | COO | | | 2020 : 0:10 0:10 1:0 | ereation in East Baton Roage Fair | | | | | | |
|---|---|--------------|-----------|----------------------|--|---|----------|---|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 13 | 3516 | Playground 1 | Play Ground; 1008.3.1 Tranfer platforms | Transfer platform, missing | 2 | Provide a compliant Transfer system. | Number | 1 | \$3,500 | \$3,500 |
| | | 14 | 3517 | Playground 2 | Play Ground; 1008.3.1 Tranfer platforms | Transfer platform, missing | 2 | Provide a compliant Transfer system. | Number | 1 | \$3,500 | \$3,500 |
| • | • | 15 | 4101 | Women's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.2 Location | Wheelchair Accessible Water closet - Centerline, not between 16 and 18 inches from side wall | 1 | See item 16. | Number | 1 | \$0 | \$0 |
| | | 16 | 4167 | Men's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.3.2 Overlap | Wheelchair Accessible Water closet - Clearance - Overlapping of elements is not allowed | 1 | Replace modular restroom building. | Number | 1 | \$80,000 | \$80,000 |
| • | 0 | 17 | 4235 | Women's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.4 Seats | Wheelchair Accessible Water closet - Seats, not between 17 and 19 inches high | 1 | See item 16. | Number | 1 | \$0 | \$0 |
| • | 6 | 18 | 4384 | Women's Restrooms | Restrooms - Wheelchair Accessible Water Closet; 604.7 Dispensers | Toilet paper dispenser - Height of outlet, not between 15 and 48 inches | 3 | See item 16. | Number | 1 | \$0 | \$0 |





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|----------------------|--------------------------------|---|----------|--------------------|--------|----------|-------------------|---------------------------|
| 19 | 4756 | Women's Restrooms | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | See item 16. | Number | 1 | \$0 | \$0 |
| 20 | 4757 | Men's Restrooms | Restrooms; 703.4.2 Location | Sign - Location - single leaf door - Latch side, missing | 2 | See item 16. | Number | 1 | \$0 | \$0 |

Totals for Woodlawn Acres Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 5) | Proposed Budget (1+2+3+4) | \$155,500 |
|----|--------------------------------|-----------|
| 4) | No Contingency Cost (Historic) | \$0 |
| 3) | Project Management (10% of 1) | \$13,178 |
| 2) | Design Cost (8% of 1) | \$10,542 |
| 1) | Estimated Cost | \$131,780 |



14939 TIGER BEND ROAD BATON ROUGE, LA 70817



Inspection Date: 7/18/18





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|-----------|---|---|----------|---|-------------|----------|-------------------|---------------------------|
| 1 | 1181 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 150 | \$30 | \$4,500 |
| 2 | 1608 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 55 | \$30 | \$1,650 |
| 3 | 1647 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| 4 | 1648 | Exterior | Accessible Route; 403.3 Slope | Walking surface - Running slope, greater than 1:20 | 1 | Build a compliant ramp. | Number | 1 | \$7,000 | \$7,000 |
| 5 | 3384 | Exterior | Parking Lot; 208.2.4 Van Parking Spaces | Van accessible - Minimum number required, less than 1 for every 6 or fraction of 6 standard accessible parking spaces | 1 | Build or rebuild van accessible parking spaces to meet the minimum number required. | Number | 1 | \$2,100 | \$2,100 |

\$26,255

Proposed Budget (1+2+3+4)

5)



(512) 410-7059 - www.alturalp.com




2018 Parks and Recreation in East Baton Rouge Parish ADA Transition Plan

| | 100 CACIC | | | 2010 Farks and Re | creation in East Baton Rouge i ai | ISII ADA ITUIISICIO | 71111011 | | | | |
|-------|-----------------|-----------|-----------------|--------------------|-----------------------------------|---------------------|-----------------|----------|--------------|---------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACT | ION UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| To | tals for W | / | dlawn V | Valking T | rail | | 1) | | | Estimated Cost | \$22,250 |
| 10 | cais for vv | | alavii v | vaiking i | I a ii | | 2) | | Des | sign Cost (8% of 1) | \$1,780 |
| Altur | a Solutions | | | | | | 3) | | Project Mana | gement (10% of 1) | \$2,225 |
| 4214 | Medical Pkwy, S | te 201 | L, Austin, TX 7 | 8756 | | | 4) | | No Continge | ncy Cost (Historic) | \$0 |



14939 TIGER BEND ROAD BATON ROUGE, LA 70817

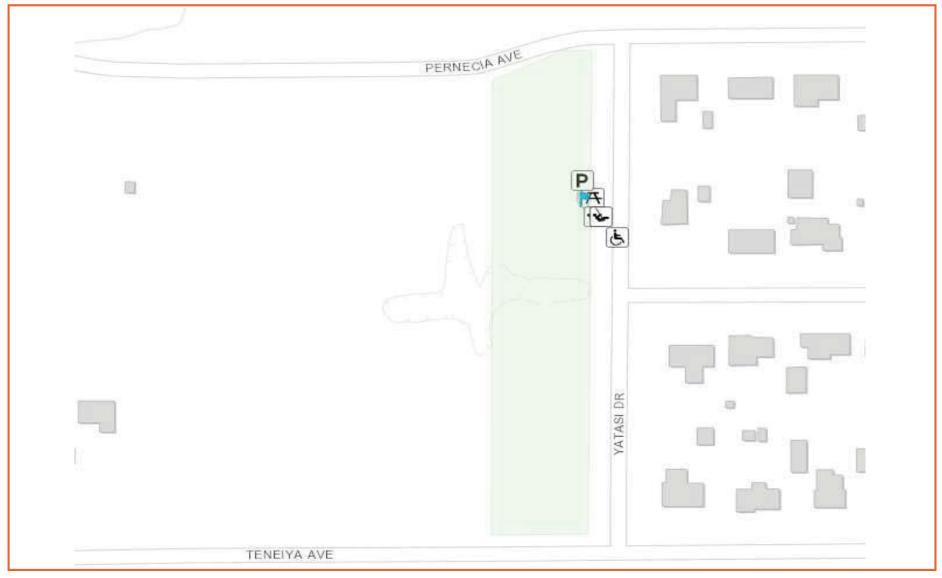

Inspection Date: 5/4/18





| REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
|--------------|-----------|------------------|---|---|----------|--|--------|----------|-------------------|---------------------------|
| 1 | 790 | Bridge | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Replace wood decking on bridge. | Number | 2 | \$1,200 | \$2,400 |
| 2 | 3262 | Exterior | Parking Lot; 208.2 Minimum Number | Standard accessible minimum number required, less than 1 (for parking space range 1 - 25) | 1 | Build 1 van accessible parking space. | Number | 1 | \$2,100 | \$2,100 |
| 3 | 3468 | Play Area. Large | Play Ground; 1008.2.6 Ground Surfaces | Ground surface - Maintenance - Use levels, not maintained to compliant level | 2 | Maintain to compliant level. | Number | 1 | \$2,000 | \$2,000 |
| 4 | 3574 | Swing | Playground; 1008.4.4 Entry Points and Seats | Entry Point/Seat - Height, not between 11 and 24 inches | 2 | Replace with a compliant entry point/seat. | Number | 1 | \$3,500 | \$3,500 |
| 5 | 4978 | Interior | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |





| REPORT GIS | LOCATIONS | BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|------------|-----------|-----------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | | CODES | | | | | | COST | PER ITEM |

Totals for Yatasi Drive Park


Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$10,500 |
|----|--|----------|
| 2) | Design Cost (8% of 1) Project Management (10% of 1) | \$840 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$12,390 |





20055 OLD SCENIC HIGHWAY ZACHARY, LA 70791

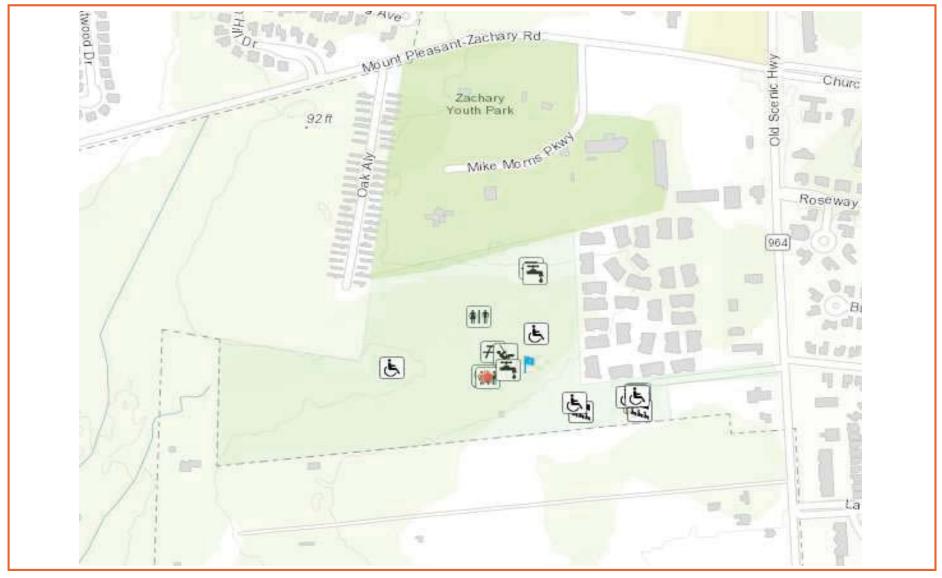

Inspection Date: 8/15/18





| | | COCO | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|---|----|--------------|-----------|---------------|--|---|----------|---|-------------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 1 | 56 | Parking Lot | Accesible Route; 405.3 Cross Slope | Curb Ramp - Cross slope, steeper than 1:48 | 1 | Rebuild the curb ramp. | Number | 2 | \$1,400 | \$2,800 |
| | 53 | 2 | 141 | Parking lot 1 | Accessible Parking Space; 502.4 Floor or Ground Surfaces | Standard Accessible Marked Parking - Clear floor space - Slope greater than 1:48 | 1 | Rebuild the space with compliant surface. | Number | 1 | \$1,800 | \$1,800 |
| | | 3 | 831 | Skate park | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 1 | \$200 | \$200 |
| | | 4 | 832 | Exterior | Accessible Route; 302.3 Floor or Ground Surface | Walking surface - Openings, could allow passage of sphere of more than 1/2 inches diameter | 1 | Fill the horizontal opening. | Number | 2 | \$200 | \$400 |
| 2 | | 5 | 1072 | Trail | Accessible Route; 403.2 Floor or Ground Surface | Walking Surface - Overall condition, not stable, firm or slip resistant | 1 | Rebuild walking surface. | Linear Feet | 5 | \$30 | \$150 |
| 7 | | 6 | 1449 | Parking Lot | Accessible Route; 403.3 Slope | Walking surface - Cross slope, greater than 1:48 | 1 | Rebuild the walking surface to have cross slope less than 1:48. | Linear Feet | 120 | \$30 | \$3,600 |





| | COOL | | | 2020 : 0:10 0:10 1:0 | ereation in East Daton Rouge Fan | | | | | | |
|---|--------------|-----------|--|---|--|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | 7 | 2260 | Area of Sport Activity | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 2 (for seating range 26 - 50) | 2 | Rebuild or relocate seats to provide a compliant number of wheelchair spaces. | Number | 2 | \$1,300 | \$2,600 |
| | 8 | 2261 | Area of Sport Activity, Skate park | Assembly Area; 221.2.1 Number and Location | Wheelchair spaces - Minimum number required, less than 2 (for seating range 26 - 50) | 2 | Rebuild or relocate seats to provide a compliant number of wheelchair spaces. | Number | 2 | \$1,300 | \$2,600 |
| 1 | 9 | 2507 | Basketball courts | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 10 | 2508 | Dog park | Drinking Fountain; 211.2 Minimum Number | Standing person accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| 5 | 11 | 2509 | Play Area | Drinking Fountain; 211.2 Minimum Number | Wheelchair accessible, less than 50% | 2 | Provide additional drinking fountains to ensuring at least 50% meet requirements of 602.2 - 602.6 and at least 50% meet the requirements of 602.7. | Number | 1 | \$2,500 | \$2,500 |
| | 12 | 2825 | Women's main restroom | Miscellaneous Element; 307 Protruding Objects - Baby changing station | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |





| | | | 10 | | 2018 Parks and Re | creation in East Baton Rouge Pari | sn ada Transitio | n Plan | | | | |
|--|------|--------------|-----------|--|---|---|------------------|---|--------|----------|-------------------|---------------------------|
| | | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| | | 13 | 2826 | Men's main restroom | Miscellaneous Element; 307 Protruding Objects - Baby changing station | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$60 | \$60 |
| | | 14 | 3033 | Exterior | Miscellaneous Element; 307 Protruding Objects - Vegetation | Protruding limits - Height, greater than 4 inches, not between 27 and 80 inches (leading edges) | 2 | Remove the protruding object or replace with a compliant element. | Number | 1 | \$150 | \$150 |
| STATE OF THE STATE | | 15 | 3544 | Play Area. Large | Play Ground; 240.2.1 Ground Level Play Components | Multiple violations. | 2 | Replace with compliant play equipment. | Number | 1 | \$250,000 | \$250,000 |
| | V | 16 | 3924 | Women's Restrooms, Walking loop | Restroom - Lavatory/Sink; 606.5 Exposed Pipes and Surfaces | Lavatory - Water supply and drain pipes under lavatory, not configured to protect against contact | 1 | Protect or cover the exposed pipes. | Number | 1 | \$220 | \$220 |
| 1.00 | 0 | 17 | 4282 | Women's Restrooms, Main restroom | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Extension from the rear wall, less than 54 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |
| | CONT | 18 | 4283 | Men's Restrooms, Main restroom | Restrooms - Wheelchair Accessible Water Closet; 604.5.1 Side Wall | Wheelchair Accessible Water closet - Side grab bar - Extension from the rear wall, less than 54 inches | 1 | Relocate side grab bar. | Number | 1 | \$250 | \$250 |





| | | | | | _ | | | | | | |
|--|--------------|-----------|--|--|--|----------|--|--------|----------|-------------------|---------------------------|
| | REPORT ID | GIS ID | LOCATIONS | BARRIERS; CODES | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED COST | BUDGETED COST PER ITEM |
| 405 | 19 | 4400 | Women's Restrooms, Main restroom | Restrooms - Wheelchair Accessible Water Closet; 604.7 Dispensers | Toilet paper dispenser - Distance from the front of the water closet to dispenser centerline, not between 7 and 9 inches | 3 | Relocate dispenser to a compliant location. | Number | 1 | \$40 | \$40 |
| a de la constant de l | 20 | 5003 | Volleyball courts | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| | 21 | 5004 | Picnic Area | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| | 22 | 5005 | Dog park | Table; 902.2 Clear Floor or Ground Space | Dining and work surfaces - Toe clearance, depth not between 17 and 25 inches | 3 | Replace with a compliant dining or work surface. | Number | 1 | \$500 | \$500 |
| 5. | 23 | 5101 | Parking lot 1 | Van Accessible Parking Space; 502.4 Floor or Ground Surfaces | Van Accessible Parking Space - Clear floor space - Slope, greater than 1:48 | 1 | Rebuild the space with compliant surface. | Number | 1 | \$1,800 | \$1,800 |





| REPORT GIS L | LOCATIONS BARRIERS; | VIOLATION | PRIORITY | RECOMMENDED ACTION | UNIT | QUANTITY | ESTIMATED | BUDGETED COST |
|--------------|---------------------|-----------|----------|--------------------|------|----------|-----------|---------------|
| ID ID | CODES | | | | | | COST | PER ITEM |

Totals for Zachary Community Park

Altura Solutions 4214 Medical Pkwy, Ste 201, Austin, TX 78756 (512) 410-7059 - www.alturalp.com

| 1) | Estimated Cost | \$275,980 |
|----|--------------------------------|-----------|
| 2) | Design Cost (8% of 1) | \$22,078 |
| 3) | Project Management (10% of 1) | \$27,598 |
| 4) | No Contingency Cost (Historic) | \$0 |
| 5) | Proposed Budget (1+2+3+4) | \$325,656 |

Totals for BREC project

| 1) | Estimated Cost | \$19,917,950 |
|----|-------------------------------|--------------|
| 2) | Design Cost (8% of 1) | \$1,593,436 |
| 3) | Project Management (10% of 1) | \$1,991,795 |
| 4) | Contingency (Historic) | \$296,705 |
| 5) | Proposed Budget (1+2+3+4) | \$23,799,886 |